
D-sub Connectors XM3/XM2S

The D-sub Connector are Ideal for Office Automation Interfacing

- Shielded against EMI.
- Multi-hole, ferrite-core Connectors (XM3B-F) offers space-saving design and superior noise protection at high frequency.
- Rugged, compact, metallized plastic hood (XM2S) provides excellent noise protection.
- Conforms to UL standards. (No. E103202) (XM2S hoods and other models not included.)
- Available with many kinds of standard Anchors and grounding fixtures.
- RoHS Compliant.

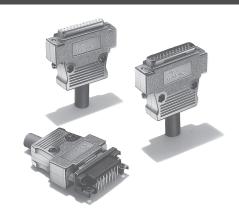

Connectors and Hoods

Model	ХМЗВ	XM3B-F
Туре	Sockets with Right-angle DIP Terminals	Sockets with Right-angle DIP Terminals and ferrite core
Appearance		

Model	хмзс	XM3F	ХМЗА	XM3D
Туре	Plugs with Right-angle DIP Terminals	Sockets with Straight DIP Terminals	Plugs with Solder Cup Terminals	Sockets with Solder Cup Terminals
Appearance				

Model		XM2S	XM2S-E		
Туре	Straight Cable Connection Metallized Plastic	Right Angle Cable Metallized Plastic for 9 and	Connection 25 terminal models	Straight Cable Connection, with ESD Production for 9 terminal models	
Appearance					

■ Ratings and Characteristics

	XM3A, XM3B, XM3B-F, XM3C (except 37 terminal models), XM3D, XM3F	XM3C - 37 terminal models	XM2S, XM2S-E (Hoods)	
Rated current	5 A	3 A		
Rated voltage	300 VAC			
Contact resistance	15 mΩ max. (at 20 mV, 100 mA max.)			
Insulation resistance	1,000 MΩ min. (at 500 VDC)	1,000 MΩ min. (at 500 VDC)		
Dielectric strength	1,000 VAC for 1 min. (leakage current	:: 1 mA max.)	7	
Total insertion force	Number of terminals x 3.33 N max.			
Removal force	0.29 N min. (for gauge diameter of 0.9	99 mm)		
Insertion Durability	200 times			
Ambient operating temperature	-55°C to 105°C (with no icing)		-25°C to 85°C	
Shield performance	Mounted in panel: 25 dB min. (30 to 9 Mounted on board: 20 dB min. (30 to			

■ Materials and Finish

Connectors

		ХМЗВ	XM3B-F	XM3C	XM3F	ХМЗА	XM3D
Housing		Fiber-glass reinfo	orced PBT resin (Fiber-glass reinforced PBT resin (UL94V-0)/Milky white			
Contacts	Mating End	Phosphor Bronze	Phosphor Bronze / Nickel base, gold plated (0.4 μm)			Bronze / Nickel base, gold plated (0.4 μm)	Phosphor Bronze / Nickel base, gold plated (0.4 µm)
	Terminals Phosphor Bronze / Nickel base, tin plated (2 μm) Phosphor Bronze / Nickel base, tin plated (3 μm)				Bronze / Nickel base, tin plated (3 µm)	Phosphor Bronze / Nickel base, tin plated (3 µm)	
Shell		Steel. Nickel plated		•			

Hoods

	XIV	XM2S-E	
	Straight Connecting Cable	Straight Connecting Cable with ESD Protection	
Housing	ABS resin /	ABS resin	
Cable clamp		Steel / nickel plated	
Lock screw (Driver type)	Steel / nickel plated		
Lock screw (Jackscrew)	Brass / nickel plated (See note) Brass / nickel plated		Fiber-glass reinforced polyamide (UL94V-0)/black


Note: Jackscrews (thumbscrews) for the straight, non-ESD version of the XM2S hood are sold separately. See "Accessories" section of this datasheet.

■ Applicable Wires

The applicable wires for solder cup terminals are AWG 22 to 28 (solid or stranded).


XM3B Sockets with Right-angle DIP Terminals

Dimensions

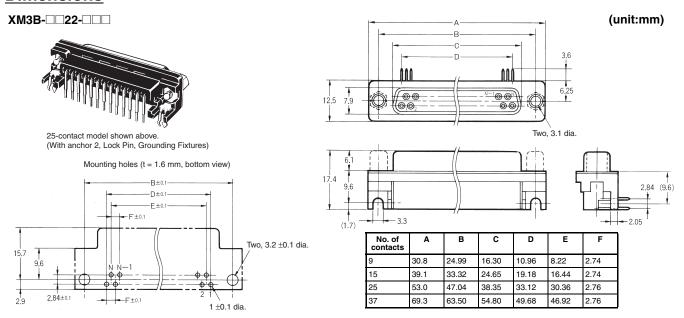

Note: XM3B Sockets were manufactured in accordance with JIS X 5101. Terminal pitches are a mixed arrangement of 2.77 and 2.74 mm contacts on 25 and 37 contact models as specified in the JIS standard. A pitch of 2.76 mm is recommended for the mounting holes because of the more advanced numerical control available today. This is sufficient to avoid any problems.

Ordering Information

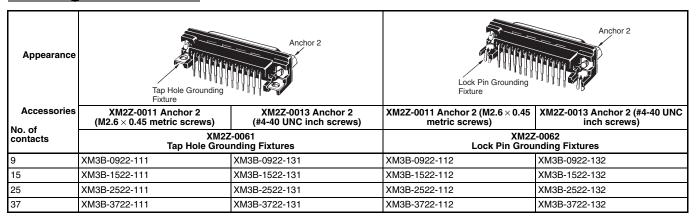

Appearance Accessories		Tap Hole Grounding Fixture	Lock Pin Grounding Fixture		
No. of contacts		No anchors XM2Z-0061 Tap Hole Grounding Fixtures	XM2Z-0062 Lock Pin Grounding Fixtures		
9	XM3B-0922	XM3B-0922-501	XM3B-0922-502		
15	XM3B-1522	XM3B-1522-501	XM3B-1522-502		
25	XM3B-2522	XM3B-2522-501	XM3B-2522-502		
37	XM3B-3722	XM3B-3722-501	XM3B-3722-502		

Note: 1. Use the XM3B-□□22 (No anchors or grounding fixtures) in combination with suitable Anchors and Grounding Fixtures.

2. Two M3 x 0.5 Tap Hole Grounding Fixtures and an M3 x 0.5 Lock Pin Grounding Fixture for the Anchor Side are provided.


XM3B-F Sockets with Right-angle DIP Terminals and Ferrite Cores

Dimensions


XM3B-□□22-501F



25-contact model shown above. (With Tap Hole Grounding Fixtures)

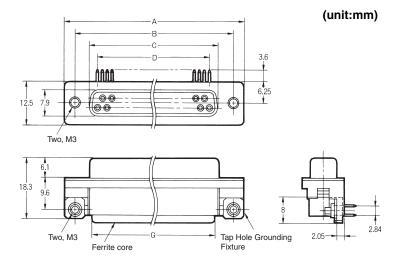

Mounting holes (t = 1.6 mm, bottom view)

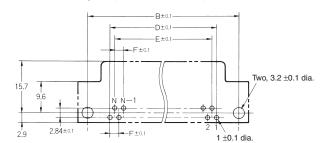

No. of contacts	Α	В	С	D	E	F	G
9	30.8	24.99	16.30	10.96	8.22	2.74	14.3
15	39.1	33.32	24.65	19.18	16.44	2.74	22.0
25	53.0	47.04	38.35	33.12	30.36	2.76	36.5
37	69.3	63.50	54.80	49.68	46.92	2.76	53.3


Note: XM3B Sockets were manufactured in accordance with JIS X 5101. Terminal pitches are a mixed arrangement of 2.77 and 2.74 mm contacts on 25 and 37 contact models as specified in the JIS standard. A pitch of 2.76 mm is recommended for the mounting holes because of the more advanced numerical control available today. This is sufficient to avoid any problems.

Appearance	Tap Hole Grounding Fixture
Accessories	XM2Z-0061 Tap Hole Grounding Fixtures
No. of contacts	
9	XM3B-0922-501F
15	XM3B-1522-501F
	XM3B-2522-501F
25	NN3D-2322-301F

XM3C Plugs with Right-angle DIP Terminals

Dimensions XM3C-□□22-□□□ (unit:mm) 6.25 25-contact model shown above 8.35 (No Anchor or Grounding Fixtures) Two, 3.1 dia. Mounting holes (t = 1.6 mm, bottom view) B±0.1 С D 15.5 16.91 10.96 8.22 2.74 1.37 15 39.1 33.32 25.25 19.18 16.44 2.74 1.37 1±0.1 dia 25 53.0 47.04 38.96 33.12 30.36 2.76 1.38 wo, 3.2±0.1 dia. 69.3 63.50 55.42 49.68


Note: XM3C Sockets were manufactured in accordance with JIS X 5101. Terminal pitches are a mixed arrangement of 2.77 and 2.74 mm contacts on 25 and 37 contact models as specified in the JIS standard. A pitch of 2.76 mm is recommended for the mounting holes because of the more advanced numerical control available today. This is sufficient to avoid any problems.

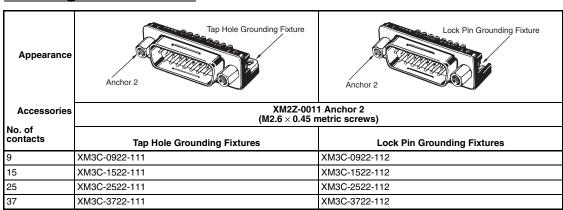

Appearance Accessories		Tap Hole Grounding Fixture	Lock Pin Grounding Fixture		
		No anchors			
No. of contacts		Tap Hole Grounding Fixtures	Lock Pin Grounding Fixtures		
9	XM3C-0922	XM3C-0922-501	XM3C-0922-502		
15	XM3C-1522	XM3C-1522-501	XM3C-1522-502		
25	XM3C-2522	XM3C-2522-501	XM3C-2522-502		
37	XM3C-3722	XM3C-3722-501	XM3C-3722-502		

- Note: 1. Use the XM3C-□□22 (No anchors or grounding fixtures) in combination with suitable Anchors and Grounding Fixtures.
 - 2. Two M3 x 0.5 Tap Hole Grounding Fixtures and an M3 x 0.5 Lock Pin Grounding Fixture for the Anchor Side are provided.
 - **3.** XM3C-□□22-□3□ versions with Inch Screws are also available.

XM3F Sockets with Straight DIP Terminals

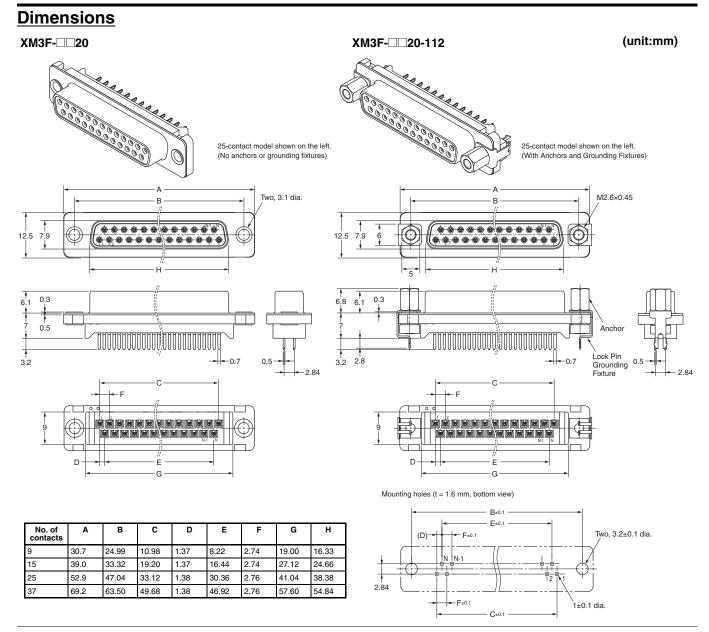

Appearance		
No. of contacts	No anchors or Grounding Fixtures	Anchors and Lock Pin Grounding Fixtures
9	XM3F-0920	XM3F-0920-112
15	XM3F-1520	XM3F-1520-112
25	XM3F-2520	XM3F-2520-112
37	XM3F-3720	XM3F-3720-112


(unit:mm)


XM3A Plugs with Solder-cup Terminals XM3D Sockets with Solder-cup Terminals

Dimensions





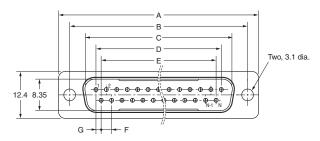




No. of contacts	Α	В	С	D	E	F	G
9	30.7	24.99	16.91	10.96	8.22	2.74	1.37
15	39.0	33.32	25.25	19.18	16.44	2.74	1.37
25	52.9	47.04	38.96	33.12	30.36	2.76	1.38
37	69.2	63.50	55.42	49.68	46.92	2.76	1.38

XM3D-□□21



Note: 25-contact model shown above.

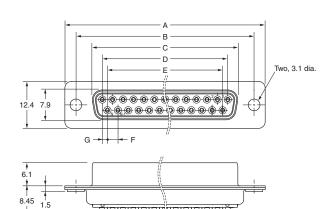

1.53 dia.

No. of contacts	Α	В	С	D	E	F	G
9	30.7	24.99	16.33	10.96	8.22	2.74	1.37
15	39.0	33.32	24.66	19.18	16.44	2.74	1.37
25	52.9	47.04	38.38	33.12	30.36	2.76	1.38
37	69.2	63.50	54.84	49.68	46.92	2.76	1.38

	Plugs	Sockets
Appearance No. of contacts		
9	XM3A-0921	XM3D-0921
15	XM3A-1521	XM3D-1521
25	XM3A-2521	XM3D-2521
37	XM3A-3721	XM3D-3721

(unit:mm)


XM2S / XM2S-E Straight and Right Angle Hoods


Dimensions

9-contact Hood with Straight Connecting Cable XM2S-091□




15, 25 and 37-contact Hood with Straight Connecting Cable XM2S-□□1□



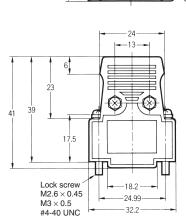

9-contact Hood

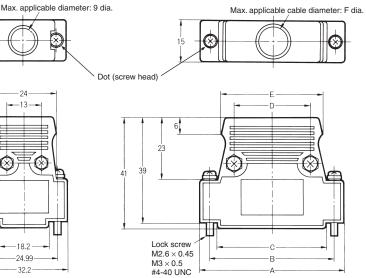


15, 25 and 37-Contact Hoods


Dot Shape					
No dot	1 dot	2 dots			
4	4	P			

No. of contacts	Α	В	С	D	E	F
15	40.5	33.32	26.5	19	30	10
25	54.0	47.04	40	29	38	11
37	70.5	63.50	57	42	50	13






25-contact Hood with Right-angle Connecting Cable XM2S-252□




Note: The maximum applicable cable diameter for the 25-contact right-angle hood is 9 dia if the cable clamp supplied is mounted facing the rear.

Do not use a cable bushing in this case.

Groove Shape				
No Groove 1 Groove 2 Grooves				

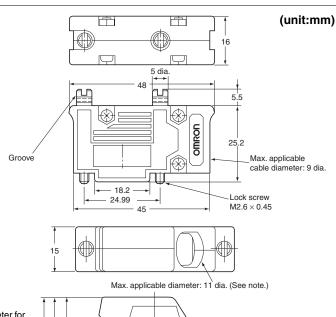


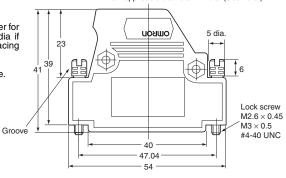



9-contact Hood with Straight Connecting Cable and ESD Protection XM2S-0911-E



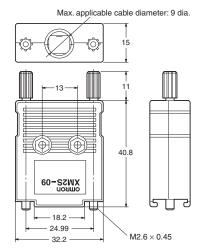

(unit:mm)

Note: Jackscrews (thumbscrews) for the straight, non-ESD version of the XM2S hood are sold separately. See "Accessories" section of this datasheet.

Ordering Information

Straight hoods

	Lock screw	M2.6 x 0.45 metric screws (No dot)	M3 x 0.5 metric screws (1 dot)	#4-40 UNC inch screws (2 dots)
Applicable	Anchor 1	XM2Z-0001	XM2Z-0002	XM2Z-0003
Anchors	Anchor 2	XM2Z-0011	XM2Z-0012	XM2Z-0013
No. of contacts	Anchor 3	XM2Z-0021	XM2Z-0022	XM2Z-0023
9		XM2S-0911	XM2S-0912	XM2S-0913
15		XM2S-1511	XM2S-1512	XM2S-1513
25		XM2S-2511	XM2S-2512	XM2S-2513
37		XM2S-3711	XM2S-3712	XM2S-3713

^{*}Jackscrews(thumbscrews) for the straight hoods without ESD protection are sold separately. See XM2Z-007 (Anchor 5) in the Accessories section of this datasheet.

Right-angle hoods

	Lock screw	M2.6 x 0.45 metric screws (No groove)	M3 x 0.5 metric screws (1 groove)	#4-40 UNC inch screws (2 groove)
Applicable Anchors	Anchor 1 (See Note 3)	XM2Z-0001	XM2Z-0002	XM2Z-0003
	Anchor 2	XM2Z-0011	XM2Z-0012	XM2Z-0013
No. of contacts	Anchor 3	XM2Z-0021	XM2Z-0022	XM2Z-0023
9		XM2S-0921	XM2S-0922	XM2S-0923
25		XM2S-2521	XM2S-2522	XM2S-2523

^{*}Jackscrews (thumbscrews) for the right-angle hoods are standard, supplied with the hoods.

Straight hood with ESD Protection

	Lock screw	M2.6 x 0.45 metric screws (No groove)
Applicable	Anchor 1	XM2Z-0001
Anchors	Anchor 2	XM2Z-0011
No. of contacts	Anchor 3	XM2Z-0021
9		XM2S-0911-E


^{*}Overmolded Jackscrews (thumbscrews) for the straight hoods with ESD protection are standard, supplied with the hoods.


- Note: 1. The cable bushing, cable clamp, shielded tape and assorted screws are supplied with all hoods
 - 2. Lock screws are attached to the Hood. Select D-sub Connectors with Anchors or Grounding Fixtures that fit the lock screw of the hood.
 - 3. Anchor 1 cannot be used with the 9 Contact Right-angle Hoods.

Accessories for XM3 (Sold Separately)

■ XM2T Dust Covers for Sockets

With Retaining Ring XM2T-□□01



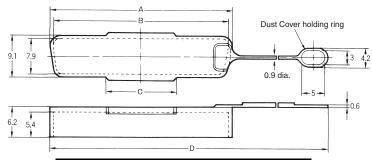


No. of contacts	Α	В	С	D	Model
9	17.7	16.3	8	68	XM2T-0901
15	26.1	24.7	10	77	XM2T-1501
25	39.8	38.4	15	120	XM2T-2501
37	56.2	54.8	18	135	XM2T-3701

Without Retaining Ring XM2T-□□01-0



XM2T Rating an	nd Material
Operating Temperature	-25°C to 85°C
Material	Polyamide resin

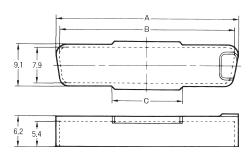

No. of contacts	Α	В	С	Model
9	17.7	16.3	8	XM2T-0901-0
15	26.1	24.7	10	XM2T-1501-0
25	39.8	38.4	15	XM2T-2501-0
37	56.2	54.8	18	XM2T-3701-0


■ XM2Z Anchors

Anchor 1 (Rectangular) XM2Z-000


Thread Type	Mod	el	
M2.6 x 0.45 metric screw	XM2Z-0	001	Materials and Finish
M3 x 0.5 metric screws	XM2Z-0	002	Zinc die-cast/nickel plate
#4-40 UNC inch screws	XM2Z-0	003	6.6-
Female (Mates screw a	with lock	M2.6 × M3 × 0. #4-40 U	5
(Mates screw a mounting	with lock nd ng screw)	M3 × 0. #4-40 L	5

Note: When using a Dust Cover, secure the holding ring at part A.


Anchor 2 (Hexagonal) XM2Z-001 ☐




Materials and Finish Iron/nickel plated




Anchor 3 (Hexagonal) XM2Z-002□






Materials and Finish




Note: Anchor 3 is used for panel mounting connectors. Applicable cable panel thickness is 0.6 to 1.3 mm.

Note: 2 anchors are necessary per connector. Anchors are not packaged in pairs.

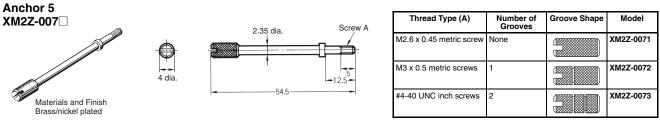

Note: Anchor 5 is for use only with the Straight Connecting XM2S hoods, to provide a Thumbscrew feature. 2 anchors are necessary per connector. Anchors are not packaged in pairs.


■ XM2Z Grounding Fixtures for XM3B

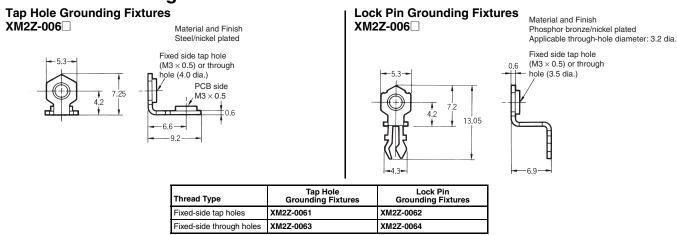

Note: 2 Grounding Fixtures are necessary per connector. Grounding Fixtures are not packaged in pairs.

Assembly Information


■ Anchors and Grounding Fixtures

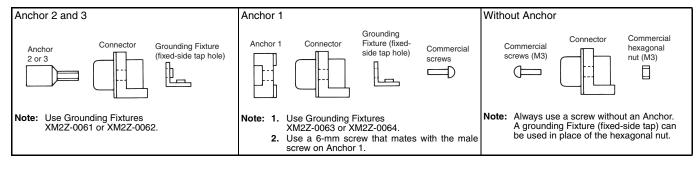

■ Combination of Hexagonal Anchors for each connector (in post installation)

Туре	Model	Without Panel Insertion	With Panel Insertion	Commercially available nut
DIP L type socket	XM3B-□□22	XM2Z-001□	XM2Z-002□	Necessary
	XM3B-□□22-501□			Not Necessary
	XM3B-□□22-502			
DIP L type plug	XM3C-□□22	XM2Z-001□	XM2Z-002□	Necessary
	XM3C-□□22-501			Not Necessary
	XM3C-□□22-502			
DIP straight socket	XM3F-□□20	XM2Z-001□	XM2Z-002□	Necessary

■ Combination Examples

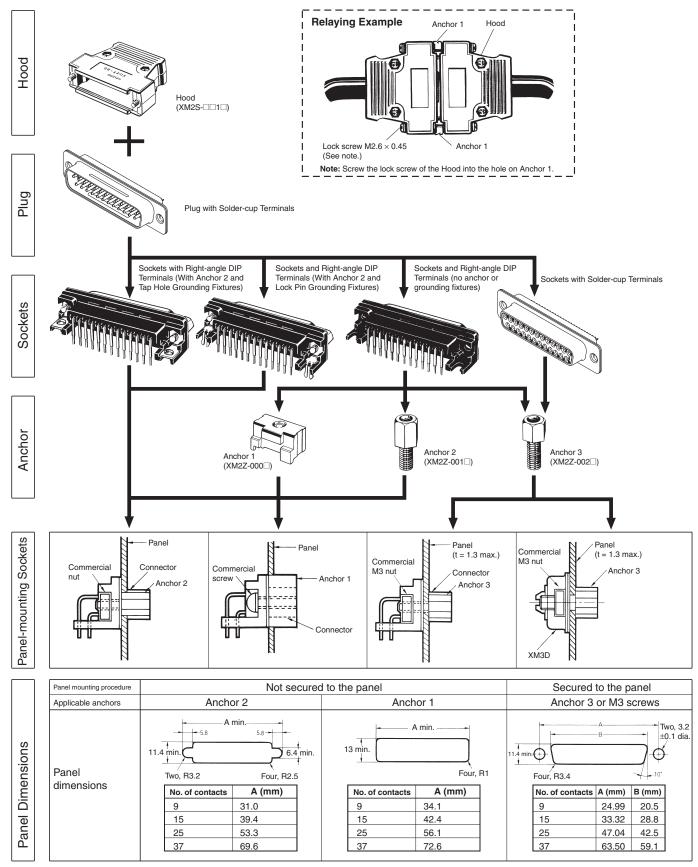

Note: 1. 2 Anchors are required per connector. Anchors are not packaged in pairs

2. Applicable panel thickness is 1.3 mm max.

Precautions


■ Correct Use

Grounding

To ground, create copper foil around the connector attachment hole on the board, assemble the connector and grounding fixture, and dip in solder as shown below.


Tap Hole Grounding Fixtures

Insert the connector into the PCB, tighten the screws, and then dip-solder the connector terminals to the board




Lock Pin Grounding Fixtures

Insert the connector into the PCB and then simultaneously dip-solder the connector terminals and lock pin to the board.




Attaching the Dust Cover

To attach the cord to the connector, use Anchor 1 and secure it as shown below.



To attach the cord to a panel, drill an M3 hole in the panel and secure the cord to it with an M3 screw. If the cord is not required, cut it off. Use a commercially available M3 screw.



Tightening Clamp Screws

Use the following torques when tightening cable clamp to hood.


Terminal Screw Tightening Torque (N·m)

9	15	25	37
Contacts	Contacts	Contacts	Contacts
0.25	0.44	0.49	

Shielded Cable Preparation

Refer to the following diagram when soldering shielded cable to the connector when using a hood.

No. of Contacts	L (mm)
9	25
15	35
25	40
37	45




- 1. Fold the unravelled braided shield back over the cable bushing
- 2. Wrap tape around the folded shield.

Shield Effects


When connecting the braided cable shield to a connector hood, use the cable clamp to clamp all the braids at once through the shielded tape.

Mate the lock screw washer and spring washer outside the connector when assembling the hood.

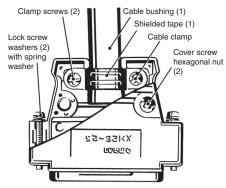

Keep the shell flange of the connector as far away from the metal panel as possible to maximize the shield effect with a connector mounted to a panel.

The ground wire for the connector will fall into the shell (external metal covering) with solder-cup terminals, so connect the ground wire to the panel or to ground on the board.



XM3A/XM3D Connector Insertion and Removal

Grasp the connector or the hood cover when inserting and removing the connector. Never try to remove the connector by pulling the cable.

Soldering - Automated Soldering Conditions. (Jet Flow) (XM3B, XM3C and XM3F)

- 1. Soldering temperature: $250 \pm 5^{\circ}C$
- 2. Continuous soldering time: Within 5 s



All sales are subject to Omron Electronic Components LLC standard terms and conditions of sale, which can be found at http://www.components.omron.com/components/web/webfiles.nsf/sales_terms.html

ALL DIMENSIONS SHOWN ARE IN MILLIMETERS.To convert millimeters into inches, multiply by 0.03937. To convert grams into ounces, multiply by 0.03527.

OMRON

OMRON ELECTRONIC COMPONENTS LLC 55 E. Commerce Drive, Suite B Schaumburg, IL 60173

847-882-2288

Cat. No. G057-E-1a

14

01/13

Specifications subject to change without notice

OMRON ON-LINE

Global - http://www.omron.com USA - http://www.components.omron.com

Printed in USA