

# **KELLER**

# HIGHLY PRECISE DIGITAL MANOMETER

# LEX 1 / LEX 1 Ei

## PRECISION\*\*: 0,01 %FS / RS485 BUS INTERFACE

LEX 1 is a micro-processor controlled, accurate and versatile digital pressure measuring instrument for calibration and testing purposes with 0,05 %FS standard accuracy. Option for precision 0,01% available as extra feature. Via the RS485 Bus Interface, communication with up to 128 connected instrument can take place.

The pressure is measured twice per second and displayed. The top display indicates the actual pressure, the bottom display shows the Max.- or Min.-pressure.

#### ATEX / IECEx

LEX 1 devices which are marked with "LEX 1 Ei" are intrinsically safe for use in hazardous areas (by approval for both ATEX and IECEx standards).

#### **Function**

LEX 1 has two operating keys. The left key is to turn the instrument on, to select the functions and the pressure units. The right key executes the selected function resp. unit or serves to display the Max.- and Min.-value.

The instrument has the following functions

With the RESET-function, the Max.- and Min.-value is set to the actual pressure

**ZERO** Using the Zero-function will set any prevailing pressure to be the new zero point

CONT The instrument turns off 15 min. after the last key function. Activating CONT (Continuous) deactivates this automatic turn-off.

UNITS All standard instruments are calibrated in bar. The pressure can be indicated in 13 different units.

## Scope of Delivery

Carrying case and 5-point calibration certificate.

## **Optional Accessories**

Long Term Stability

Carrying bag, protective rubber covering, interface converter K-114A





LEX 1 with piezoresistive pressure sensor



LEX 1 with capacitive pressure sensor

## Standard Pressure Ranges 1 LEX 1 (Ei) piezoresistive

	Ranges	Resolution Display	<u>Overpressure</u>		
PAA/PR	-12 bar	0,1 mbar	6 bar		
PAA/PR	-110 bar	1 mbar	20 bar		
PAA/PR	-120 bar	1 mbar	40 bar		
PA	0200 bar	10 mbar	400 bar		
PA	0400 bar	20 mbar	800 bar		
PA	0700 bar	50 mbar	1100 bar		
PA	01000 bar	100 mbar	1100 bar		
Accuracy, Error Band (050 °C)	≤ 0,05 %FS				
Long Term Stability	Reference: 1 mbar or 0,05 %FS Absolute: 0,5 mbar or 0,025 %FS				
Optional: Precision	0,01 %FS (only for piezoresistive PA or PAA and ranges ≥ 10 bar)				

## Standard Pressure Ranges 1 LEX 1 (Ei) capacitive

	Ranges	Resolution Display	Overpressure	Neg. Overpressure
PR/PD <sup>2</sup>	30 mbar	0,01 mbar	300 mbar	30 mbar
PR/PD <sup>2</sup>	100 mbar	0,01 mbar	1000 mbar	100 mbar
PR/PD <sup>2</sup>	300 mbar	0,1 mbar	1500 mbar	300 mbar
Accuracy, Error Band (050 °C)	≤ 0.2 %FS			

<sup>1</sup> Other pressure ranges as well as instruments with relative pressure measuring cells, on request <sup>2</sup> For the PD version, a tube connection Ø 6 mm for the reference is available

PA = Absolute. Zero at atmospheric pressure PD = Differential. PR = Vented Gauge. Zero at atmospheric pressure PAA = Absolute. Zero at vacuum

## I FX 1 Fi

#### Intrinsically Safe Version, 94/9/CE and IECEx

Classification: 🐼 II 2 G Ex ia IIC T6 Gb Certifications File PTB 05 ATEX 2012 X and IECEx PTB 13.0028X

In comparision to the standard LEX1 the Ex-proof intrinsically safe version has internally more enhanced protective components mounted and is marked with the EX-logo.

Functions, ranges and accuracy are identical to the standard LEX 1 version

The factory setting of the zero for the ranges ≤ 61 bar absolute is at vacuum (0 bar absolute). For relative pressure measurements, activate "ZERO SEt" at ambient pressure. Instruments > 61 bar absolute or instruments with a relative pressure sensor (label marked with: Range: rel) are calibrated with the zero at

Subject to alterations

FS ≥ 100 mbar: ± 0.1 %FS FS ≤ 100 mbar: ± 0.1 mbar

KELLER AG für Druckmesstechnik St. Gallerstrasse 119 CH-8404 Winterthur Tel. +41 (0)52 - 235 25 25 Fax +41 (0)52 - 235 25 00 KELLER Ges. für Druckmesstechnik mbH Schwarzwaldstrasse 17 D-79798 Jestetten Tel. +49 (0)7745 - 9214 - 0 Fax +49 (0)7745 - 9214 - 60

Companies approved to ISO 9001 www.keller-druck.com



# **KELLER**

#### **Specifications**

Number of Digits of the LCD Display Measuring Rate (Display LCD) Measuring Rate via Serial Interface Storage- / Operating Temperature Medium Temperature Pressure Sensor

Compensated Temperature Range

Battery Battery Life

Pressure Connection
Bus Interface<sup>3</sup>
Electrical Connection<sup>3</sup>

External Supply<sup>3</sup>

Temperature Measurement Material in Contact with Media

Protection

Diameter x Height x Depth (approx.)

Weight (approx.)

5 digit

2 x per second

Pressure up to 15 x per second

-10...60 °C / 0...50 °C

-20...80 °C, others on request

LEX 1 Ei max. 60 °C

0...50 °C

3 V battery, Typ CR 2430

approx. 2'000 hours continuous operation

G1/4" (other threads on request) RS485 (KELLER bus protocol)

External supply and RS485 communication via Fischer D103A054, flange socket fits with PCconverter cable K-114A (USB to RS485)

8...28 VDC

Accuracy typ. 0,5 °C

Stainless Steel (AISI 316L), Viton® O-ring.

In addition with LEX 1 capacitive: gold plated ceramic

diaphragm, Nitril O-ring

IP65

LEX 1 piezoresistive LEX 1 capacitive 76 x 118 x 55 mm 76 x 148 x 55 mm

300 g 335 g

#### Scope of Delivery

5-point calibration certificate and carrying case





#### \*\* Accuracy and Precision


"Accuracy" is an absolute term, "Precision" a relative term. Dead weight testers are primary standards for pressure, where the pressure is defined by the primary values of mass, length and time. Highest class primary standards in national laboratories indicate the uncertainty of their pressure references with 70 to 90 ppM or close to 0,01%.

Commercial dead weight testers as used in our facilities to calibrate the transmitters and manometers indicate an uncertainty or accuracy of 0,025%. Below these levels, KELLER use the expression "Precision" as the ability of a pressure transmitter or manometer to be at each pressure point within 0,01 %FS relative to these commercial standards.

The manometer's full-scale output can be set up to match any standard of your choice by correcting the gain with a calibration software.

#### **Computer Software CCS30**

Pressure and temperature readings can be displayed and recorded on a PC or Laptop with the help of the software ControlCenter-Series30 (CCS30) and a serial interface cable K-103A (RS232) or K-114A (USB). The software also enables the configuration of the zero point settings. The KELLER bus protocol and programming examples in various programming languages are available. This allows very quick and easy implementation into customer software applications. Up to 128 devices can be connected together into a KELLER Bussystem.

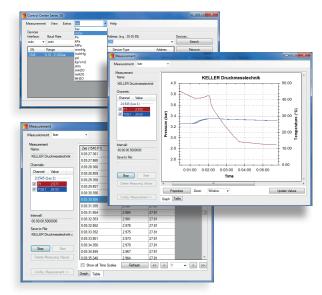

Subject to alterations 07/2014

KELLER AG für Druckmesstechnik
KELLER Ges. für Druckmesstechnik mbH

St. Gallerstrasse 119 Schwarzwaldstrasse 17 CH-8404 Winterthur D-79798 Jestetten Tel. +41 (0)52 - 235 25 25 Tel. +49 (0)7745 - 9214 - 0

Fax +41 (0)52 - 235 25 00 Fax +49 (0)7745 - 9214 - 60

www.keller-druck.com

<sup>&</sup>lt;sup>3</sup> In the Ex-Zone, the LEX 1 Ei gauges are not allowed to be supplied externally, nor can they be connected via the RS485 interface.