

# 2SC1213, 2SC1213A


# Silicon NPN Epitaxial

REJ03G0684-0200 (Previous ADE-208-1048) Rev.2.00 Aug.10.2005

#### **Application**

- Low frequency amplifier
- Complementary pair with 2SA673 and 2SA673A

#### **Outline**

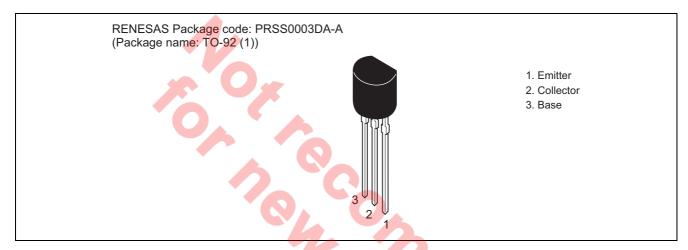

### **Absolute Maximum Ratings**

 $(Ta = 25^{\circ}C)$ 

Item	Symbol	2SC1213	2SC1213A	Unit
Collector to base voltage	V <sub>CBO</sub>	35	50	V
Collector to emitter voltage	$V_{CEO}$	35	50	V
Emitter to base voltage	$V_{EBO}$	4	4	V
Collector current	I <sub>C</sub>	500	500	mA
Collector power dissipation	Pc	400	400	mW
Junction temperature	Tj	150	150	°C
Storage temperature	Tstg	-55 to +150	-55 to +150	°C

#### **Electrical Characteristics**

 $(Ta = 25^{\circ}C)$ 


		:	2SC1213	3	2	SC1213	A		
Item	Symbol	Min	Тур	Max	Min	Тур	Max	Unit	Test conditions
Collector to base breakdown voltage	V <sub>(BR)CBO</sub>	35	_	_	50	-	_	V	$I_C = 10 \mu A, I_E = 0$
Collector to emitter breakdown voltage	V <sub>(BR)CEO</sub>	35	_	_	50	_	_	V	$I_C = 1 \text{ mA}, R_{BE} = \infty$
Emitter to base breakdown voltage	$V_{(BR)EBO}$	4	_	_	4	_	_	V	$I_E = 10 \mu A, I_C = 0$
Collector cutoff current	I <sub>CBO</sub>		_	0.5	_		0.5	μΑ	$V_{CB} = 20 \text{ V}, I_{E} = 0$
DC current transfer ratio	h <sub>FE</sub> *1	60	_	320	60	_	320		$V_{CE} = 3 \text{ V}, I_{C} = 10 \text{ mA}$
	h <sub>FE</sub>	10	_	_	10		_		$V_{CE} = 3 \text{ V},$ $I_{C} = 500 \text{ mA}^{*2}$
Collector to emitter saturation voltage	V <sub>CE(sat)</sub>	_	0.2	0.6	_	0.2	0.6	V	I <sub>C</sub> = 150 mA, I <sub>B</sub> = 15 mA* <sup>2</sup>
Base to emitter voltage	V <sub>BE</sub>		0.64	_	_	0.64	_	V	$V_{CE} = 3 \text{ V}, I_{C} = 10 \text{ mA}$

Notes: 1. The 2SC1213 and 2SC1213A are grouped by hFE as follows.


#### 2. Pulse test

2. F	Pulse test		
В	С	D	<b>*</b>
60 to 120	100 to 200	160 to 320	

#### **Main Characteristics**

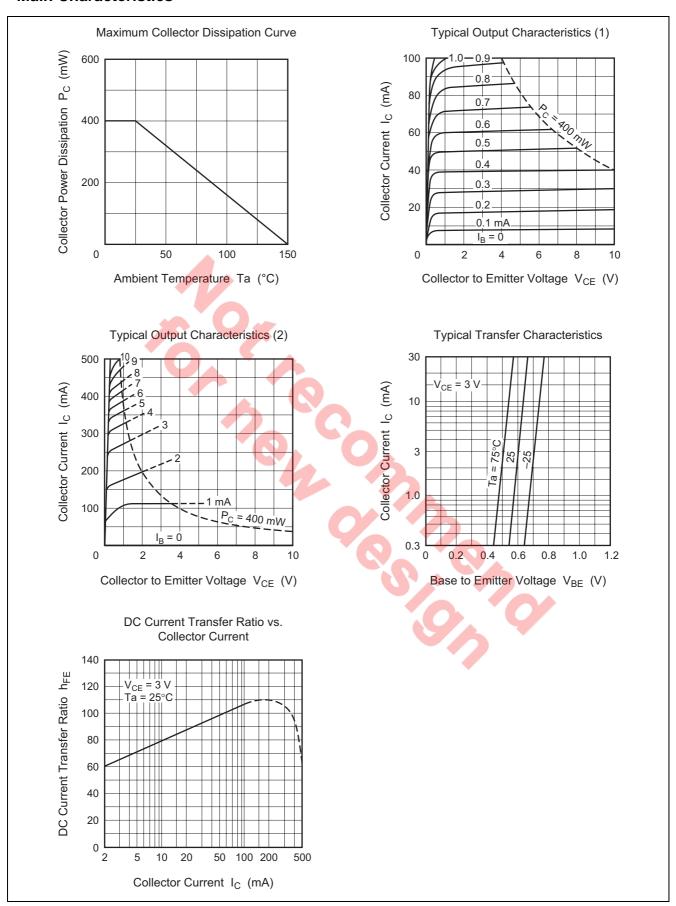

# **Package Dimensions**

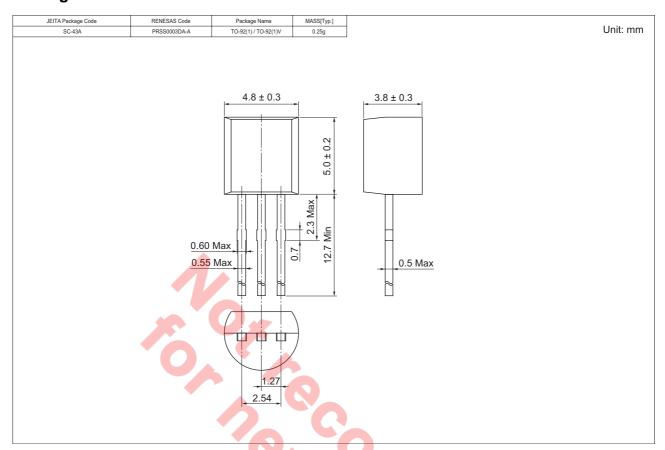

# **Ordering Information**

Part Name	Quantity	Shipping Container
2SC1213CTZ-E	2500	Hold Box, Radial Taping
2SC1213DTZ-E		
2SC1213ABTZ-E		
2SC1213ACTZ-E		
2SC1213ADTZ-E		

Note: For some grades, production may be terminated. Please contact the Renesas sales office to check the state of production before ordering the product.

Renesas Technology Corp. Sales Strategic Planning Div. Nippon Bldg., 2-6-2, Ohte-machi, Chiyoda-ku, Tokyo 100-0004, Japan

Keep safety first in your circuit designs!

1. Renesas Technology Corp. puts the maximum effort into making semiconductor products better and more reliable, but there is always the possibility that trouble may occur with them. Trouble with semiconductors may lead to personal injury, fire or property damage.

Remember to give due consideration to safety when making your circuit designs, with appropriate measures such as (i) placement of substitutive, auxiliary circuits, (ii) use of nonflammable material or (iii) prevention against any malfunction or mishap.

#### Notes regarding these materials

Notes regarding these materials

1. These materials are intended as a reference to assist our customers in the selection of the Renesas Technology Corp. product best suited to the customer's application; they do not convey any license under any intellectual property rights, or any other rights, belonging to Renesas Technology Corp. or a third party.

2. Renesas Technology Corp. assumes no responsibility for any damage, or infringement of any third-partys rights, originating in the use of any product data, diagrams, charts, programs, algorithms, or circuit application examples contained in these materials.

3. All information contained in these materials, including product data, diagrams and algorithms represents information on products at the time of publication of these materials, and are subject to change by Renesas Technology Corp. without notice due to product improvements or other reasons. It is therefore recommended that customers contact Renesas Technology Corp. or a authorized Renesas Technology Corp. product distributor for the latest product information before purchasing a product listed herein.

The information described here may contain technical inaccuracies or typographical errors.

Renesas Technology Corp. assumes no responsibility for any damage, liability, or other loss rising from these inaccuracies or errors. Please also pay attention to information published by Renesas Technology Corp. by various means, including the Renesas Technology Corp. Semiconductor home page (http://www.renesas.com).

4. When using any or all of the information contained in these materials, including product data, diagrams, charts, programs, and algorithms, please be sure to evaluate all information as a total system before making a final decision on the applicability of the information and products. Renesas Technology Corp. semiconductors are not designed or manufactured for use in a device or system that is used under circumstances in which human life is potentially at stake. Please contact Renesas Technology Corp.

ENESA

Refer to "http://www.renesas.com/en/network" for the latest and detailed information.

**RENESAS SALES OFFICES** 

**Renesas Technology America, Inc.** 450 Holger Way, San Jose, CA 95134-1368, U.S.A Tel: <1> (408) 382-7500, Fax: <1> (408) 382-7501

Renesas Technology Europe Limited
Dukes Meadow, Millboard Road, Bourne End, Buckinghamshire, SL8 5FH, U.K.
Tel: <44> (1628) 585-100, Fax: <44> (1628) 585-900

Renesas Technology Hong Kong Ltd.

7th Floor, North Tower, World Finance Centre, Harbour City, 1 Canton Road, Tsimshatsui, Kowloon, Hong Kong Tel: <852> 2265-6688, Fax: <852> 2730-6071

**Renesas Technology Taiwan Co., Ltd.** 10th Floor, No.99, Fushing North Road, Taipei, Taiwan Tel: <886> (2) 2715-2888, Fax: <886> (2) 2713-2999

Renesas Technology (Shanghai) Co., Ltd. Unit2607 Ruijing Building, No.205 Maoming Road (S), Shanghai 200020, China Tel: <86> (21) 6472-1001, Fax: <86> (21) 6415-2952

Renesas Technology Singapore Pte. Ltd.

1 Harbour Front Avenue, #06-10, Keppel Bay Tower, Singapore 098632 Tel: <65> 6213-0200, Fax: <65> 6278-8001

Renesas Technology Korea Co., Ltd. Kukje Center Bldg. 18th Fl., 191, 2-ka, Hangang-ro, Yongsan-ku, Seoul 140-702, Korea Tel: <82> 2-796-3115, Fax: <82> 2-796-2145

Unit 906, Block B, Menara Amcorp, Amcorp Trade Centre, No.18, Jalan Persiaran Barat, 46050 Petaling Jaya, Selangor Darul Ehsan, Malaysia Tel: <603> 7955-9390, Fax: <603> 7955-9510

© 2005. Renesas Technology Corp., All rights reserved. Print	ed in Japan.
--	--------------

http://www.renesas.com