


## Test Procedure for the NCV891330-3.3V DEMO BOARD

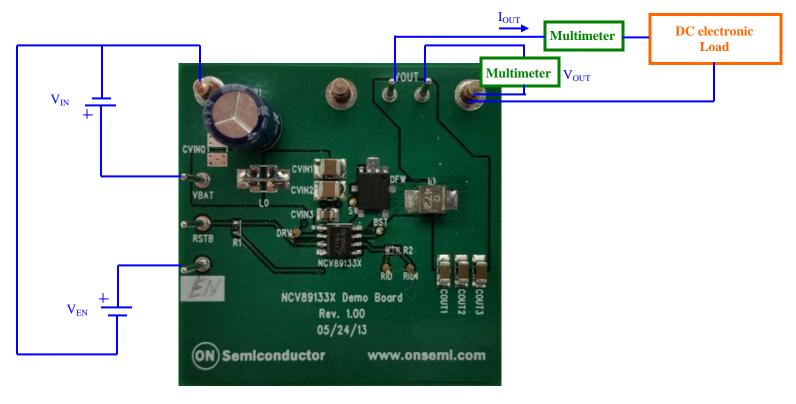

## **Required Equipment**

| 2 x DC voltage source  |
|------------------------|
| 1 x DC electronic load |
| 2 x Multimeters        |

## **Test Procedure:**

- 1. Connect the test setup as shown above.
- 2. Make sure the load is not enabled.
- 3. Apply an enable voltage  $V_{EN}=0V$ . Apply an input voltage,  $V_{IN}=13.2~V$ .  $V_{OUT}$  should be 0V.
- 4. Apply an enable voltage  $V_{EN}=3V$ . Verify that the *output voltage is 3.3 V* +/-0.1 V.
- 5. Set up the **load to 2.5A** and **enable** it. Verify that the *output voltage is still 3.3 V* +/-0.1 V.
- 6. Change the **input voltage to 39 V**. Verify that the *output voltage is 0 V*.
- 7. Change the **input voltage to 36 V**. Verify that the *output voltage is 3.3 V* +/-0.1 V.
- 8. Change the **input voltage to 3.8 V**. Verify that the *output voltage is above 2.5 V*.
- 9. Change the **input voltage to 3.0 V**. Verify that the *output voltage is 0 V*.
- 10. Change the **input voltage to 4.5 V**. Verify that the *output voltage is 3.3 V* +/-0.1 V.
- 11. Apply an enable voltage  $V_{EN}=0V$ .  $V_{OUT}$  should be 0V.
- 12. Turn off the DC sources.