Permanent Magnet and Magnetic Particle Clutches and Brakes



An Altra Industrial Motion Company

Precision Tork

Permanent Magnet Clutches and Brakes

Precision Tork units provide constant torque independent of slip speed. They offer excellent overload and jam protection for all drive train components and also provide soft starts with zero slip when a preset torque is reached. Precision Tork permanent magnet clutches and brakes do not require maintenance and provide extremely long life.

Magnetic Particle Clutches and Brakes



Warner Electric Precision Tork magnetic particle clutches and brakes are unique because of the wide operating torque range available. Torque to current is almost linear and can be controlled very accurately. The unique features of the magnetic particle clutches and brakes make them ideal for tension control, load simulation, cycling/indexing, and soft starts and stops.

Magnetic Capping Headsets

Warner Electric Precision Tork Magnetic Capping Headsets are 100% interchangable with many major OEM headsets. Warner Electric headsets feature constant Smooth Torque Technology. They are easy to install and maintain with little adjustment required. The Precision Tork headset has a unique visual scale for setting both application torque & the top load spring.

Permanent Magnet Clutches and Brakes

Features and Benefits	1
Special Applications	1
Applications	2
Specifications	3
Mounting Arrangements	3
Stainless Steel Designs	4
Hollow Bore Units	6
Solid Shaft Units	7
Mounting Bracket	7
Heat Dissipation Charts	8
Torque Setting Charts	9
Stub Shaft Adapters	10
How to Order	10

Magnetic Particle Clutches and Brakes

Features and Benefits	12
Design and Operation	13
Selection	14
Applications	16
Clutches - Dimensions and Specifications	19
Mounting Bracket	19
Brakes - Dimensions and Specifications	20
Controls	21

Magnetic Capping Headsets

Replacements	22
Features and Benefits	23
Models Available	23
Dairy Capchucks	24
Chucks and Knives	25





Fast, precise torque adjustment!

Precision Tork[™] clutches and brakes

Precision Tork units provide constant torque independent of slip speed. They offer excellent overload and jam protection for all drive train components and also provide soft starts with zero slip when a preset torque is reached. Precision Tork permanent magnet clutches and brakes do not require maintenance and provide extremely long life.

Features and Benefits

Fast, precise torque adjustment

- Torque is set with a large knurled adjustment ring.
- Infinite adjustability between minimum and maximum settings. This allows units to be fine tuned to your unique requirement.
- Easy to read graduations.

Torque is constant with respect to speed

- By using the Precision Tork unit, you can solve almost any torque control problem.
- Torque is extremely consistent and smooth at low, as well as high speeds.

No external control or power source

- Simple to install
- Nothing to monitor
- Unaffected by power interruption or power fluctuation
- Safe to use

Dependable performance


- Smallest possible transition from static to dynamic torque. Virtually eliminates the "stick-slip" phenomenon associated with friction devices.
- Long life. The only wearing parts are the ball bearings.
- Extremely accurate. Precision Tork units out-perform all other devices at low RPM.

Versatile mounting: Easy to retrofit

- Clutches are available with hollow bores for mounting on motor shafts or jack shafts.
- · Bolt circles allow for fixed mounting, adding a pulley, or stub shaft adapters.
- Brakes are available with solid shaft outputs.

Distributor item

- Off the shelf availability.
- Interchangeable with competitors' products.

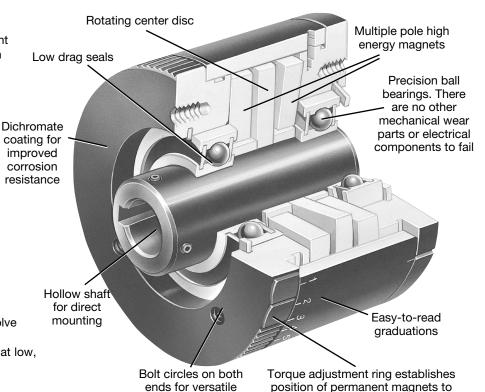

ends for versatile mounting

vary the amount of torque

Specials are our business...

- Special shaft bores and keyways
- Shaft extensions
- System retrofits
- Metric bores and keyways
- Stainless steel construction
- Fixed torque units

Stainless Steel

MC4D

Long Shaft Extension

Applications

Unwind tension control

Brake mounted on shaft of unwind spool or bobbin.



Cycling

Bottle

capping

Constant torque

hysteresis clutch.

provided by a

Information required:

Full roll diameter (in.) = 6 in. Core diameter (in.) = 4 in. Average tension (lbs.) = 4 lbs. Velocity (feet per min.) = 100 fpm

How to size:

Δ

Average radius (in.) =
Full roll dia. (in.) + Core dia. (in)
=
$$-\frac{6+4}{4}$$
 = 2.5 in.

Torque (lb.in.) =

Avg. tension (lbs.) x Avg. radius (in.) $= 4 \times 2.5 = 10$ lb.in.

Information required:

Slip RPM = 500 RPM Torque = 8 lb.in. % slip time of total cycle time = 25%

How to size:

*Watts = .0118 x torque (lb.in.) x slip RPM x % slip time = $.0118 \times 8 \times$ 500 x .25 = 11.8 watts

Check tension range:

Max. tension = Torque (lb.in.) x

$$\frac{2}{\text{Core dia. (in.)}} = 10 \times \frac{2}{4} = 5 \text{ lbs.}$$

Min. tension = Torque (lb.in.) x

Slip watts =

Max. tension (lbs.) x velocity (fpm) 44.2


= 11.3 watts

Select Model MC4

Select an MC4 from the specification chart.


*Note: Consult factory if peak slip watts are extremely high or if duration of slip period is in excess of 1 minute.

Nip roll or pulley tension control

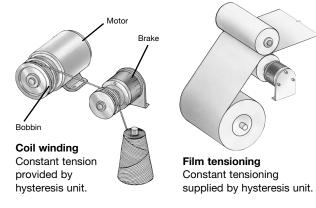

Clutch

Information required:



How to size:


Torque (lb.in.) = Tension (lbs.) x $\frac{\text{Dia. (in.)}}{2}$ = 6 x $\frac{4}{2}$ = 12 lb.in.

Slip watts =
$$\frac{\text{Tension (lbs.) x velocity (fpm)}}{44.2} = \frac{6 \times 100}{44.2} = 13.5 \text{ watts}$$


Select Model MC5

Overload protection/Torque limiting/Soft start

Motor horsepower method

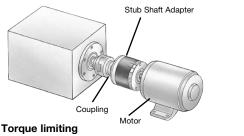

Hysteresis clutch provides overload protection.

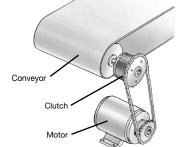

Material handling Hysteresis clutch can provide overload protection and soft start.

Information required:

Motor HP = 1/2 HP Motor RPM = 1750 RPM

How to size:

HP x 63000 Torque (lb.in.) RPM


$$\frac{1/2 \times 63000}{1750} = 18 \text{ lb.in.}$$

Select an MC5 from the specification chart.

Standard Clutches and Brakes


Specifications	Model Size	D Torque	Heat Dissipation (watts)	Inertia (lbs. sq. in.)	Bending Moment (Ib. in.)	Max. RPM	Weight (lbs.)	Bore Range/Shaft Dia. (in.)
	MC1.5	1–13 oz. in.	10	0.02	5	3600	10.5 oz.	1/4
	MC2	0.5–22 oz. in	. 10	0.02	5	3600	11 oz.	1/4
	MC2.5	0.5–5.5 lb. in	. 15	0.11	10	1800	1.5	3/8, 1/2
	MC3	0.5–6 lb. in.	18	0.14	10	1800	2.5	5/16, 3/8
	MC4	0.7–10 lb. in.	22	0.32	10	1800	3.5	3/8, 1/2, 5/8
	MC5	1–30 lb. in.	72	1.72	25	1800	9.5	3/8, 1/2, 5/8, 3/4, 7/8, 1
	MC5.5	1–50 lb. in.	110	2.74	25	1800	12	3/8, 1/2, 5/8, 3/4, 7/8, 1
Hollow Bore Configurations	MC6	1–68 lb. in.	150	4.28	25	1800	12	3/8, 1/2, 5/8, 3/4, 7/8, 1
e egu a le le	MC6D	6–136 lb. in.	300	8.52	25	1800	24	1/2, 5/8, 3/4, 7/8, 1
	MC9	15–300 lb. in	. 345	65.74	50	1200	48 5/	8, 3/4, 7/8, 1, 1-1/8, 1-1/4
	MB1	0-1.1 oz. in.	3	0.001	1	3600	2.5 oz.	3/16
	MB1.5	1–13 oz. in.	10	0.02	5	3600	11 oz.	1/4
	MB2	.5-22 oz. in.	10	0.02	5	3600	11.5 oz.	1/4, 3/8
	MB2.5	.5–5.5 lb. in.	15	0.11	10	1800	2.5	3/8, 1/2
	MB3	0.5–6 lb. in.	18	0.14	10	1800	2	3/8
	MB4	0.7–10 lb. in.	22	0.33	10	1800	3.5	1/2, 5/8
	MB5	1–30 lb. in.	72	1.76	25	1800	10	1
Solid Shaft Configurations	MB5.5	1–50 lb. in.	110	2.79	25	1800	12.5	1
.	MB6	1–68 lb. in.	150	4.33	25	1800	12	1
	MB6D	6–136 lb. in.	300	8.68	25	1800	26	7/8
	MB9	15–300 lb. in	. 345	66.09	50	1200	48	1

Typical Mounting Arrangements

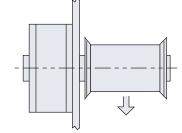


Brake:

Typical setup for tensioning wire, film and fibers.

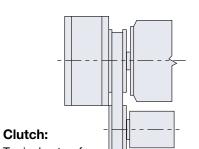

Typical setup for material handling, soft starts and torque limiting. Stub Shaft Adapter



Clutch Coupling:

Typical setup for torque limiting protection used for labeling, capping and printing applications.

Stainless Steel Clutches and Brakes

Specifications	Model Size	D Torque	Heat Dissipation (watts)	Inertia (Ibs. sq. in.)	Bending Moment (lb. in.)	Max. RPM	Weight (lbs.)	Bore Range/Shaft Dia. (in.)
	MC1.5	1–13 oz. in.	10	0.02	5	3600	10.5 oz.	1/4
	MC2	0.5–22 oz. in.	. 10	0.02	5	3600	11 oz.	1/4
	MC2.5	0.5–5.5 lb. in.	. 15	0.11	10	1800	1.5	3/8, 1/2
W Contraction	MC3	0.5–6 lb. in.	18	0.14	10	1800	2.5	5/16, 3/8
e e	MC4	0.7–10 lb. in.	22	0.32	10	1800	3.5	3/8, 1/2, 5/8
Hollow Bore	MC5	1–30 lb. in.	72	1.72	25	1800	9.5	3/8, 1/2, 5/8, 3/4, 7/8, 1
Configurations	MC5.5	1–50 lb. in.	110	2.74	25	1800	12	3/8, 1/2, 5/8, 3/4, 7/8, 1
	* Size 6I	D NS 9 are no	t currently a	available as st	ainless ste	el prod	lucts.	
All is a second s	MB1	0-1.1 oz. in.	3	0.001	1	3600	2.5 oz.	3/16
	MB1.5	1–13 oz. in.	10	0.02	5	3600	11 oz.	1/4
· ·	MB2	.5-22 oz. in.	10	0.02	5	3600	11.5 oz.	1/4, 3/8
	MB2.5	.5–5.5 lb. in.	15	0.11	10	1800	2.5	3/8, 1/2
	MB3	0.5–6 lb. in.	18	0.14	10	1800	2	3/8
Solid Shaft Configurations	MB4	0.7–10 lb. in.	22	0.33	10	1800	3.5	1/2, 5/8
j -	MB5	1–30 lb. in.	72	1.76	25	1800	10	1
	MB5.5	1–50 lb. in.	110	2.79	25	1800	12.5	1
	MB6	1–68 lb. in.	150	4.33	25	1800	12	1
	MC6	1–68 lb. in.	150	4.28	25	1800	12	3/8, 1/2, 5/8, 3/4, 7/8, 1

Magnetic Clutches and Brakes


Stainless steel clutches and brakes for harsh environments

Caustic washdown solutions can cause corrosion and eventual failure in food processing applications such as meat and poultry. That's why we have introduced a new line of all stainless steel clutches and brakes. These units, featuring 400 series stainless steel bearings, are robust enough to handle the most hostile washdown environments and tough enough to perform 24/7.









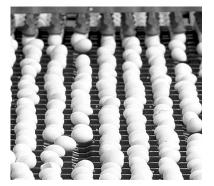

Hollow Bore Configurations

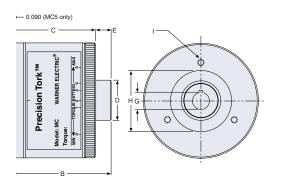

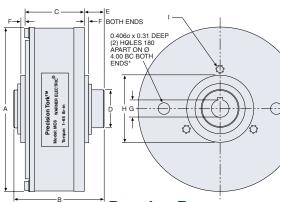

Drawing A


Drawing B


*Set scre	w adjustment			t			
Model	Drawing	Α	В	С	D	E	F
MC1.5	А	1.85	1.62	1.38	0.375	0.24	_
MC2	А	1.85	1.62	1.35	0.375	0.27	-
MC2.5	А	2.31	2.52	2.23	0.79	0.29	-
MC3	А	2.74	2.22	1.98	0.590	0.24	-
MC4	А	3.23	2.27	2.01	0.98	0.26	-
MC5	А	4.65	3.18	2.64	1.372	0.45	-
MC5.5	А	5.29	3.21	2.64	1.372	0.57	-
MC6	В	6.05	3.18	2.02	1.372	0.76	0.18
MC6D	В	7.15	5.03	4.06	1.378	0.59	0.29
MC9	В	9.40	4.18	3.49	1.77	0.56	0.13

Bore & Keyseat Sizes

Model	Keyseat	Lockdown Method	G (Bore)	H (Pilot-Both Ends)	l (Both Ends)
MC1.5	None	3/32 Roll Pin	1/4	0.877–0.876 x 0.08 dp	3) 6-32 x 5/16 dp 1.25 B.C.
MC2	None	3/32 Roll Pin	1/4	0.877–0.876 x 0.08 dp	3) 6-32 x 5/16 dp 1.25 B.C.
MC2.5	None 1/8 Key	2) Set Screws 2) Set Screws	3/8 1/2	1.655–1.653 x 0.10 dp	3) 10-32 x 7/16 dp 1.875 B.C.
MC3	None None	2) Set Screws 2) Set Screws	5/16 3/8	1.383/1.381 x .120 dp	3) 10-32 x 7/16 dp 1.875 B.C.
MC4	None 1/8 Key 3/16 Key	2) Set Screws 2) Set Screws 2) Set Screws	3/8 1/2 5/8	1.854–1.852 x 0.08 dp	3) 10-32 x 7/16 dp 2.375 B.C.
MC5	None 1/8 Key 3/16 Key 3/16 Key 3/16 Key 1/4 Shallow	2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws	3/8 1/2 5/8 3/4 7/8 1	2.441/2.440 x .10 dp	3) 10-32 x 1/2 dp 3.00 B.C.
MC5.5	None 1/8 Key 3/16 Key 3/16 Key 3/16 Key 1/4 Shallow	2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws	3/8 1/2 5/8 3/4 7/8 1	2.441/2.440 x .26 dp	3) 10-32 x 1/2 dp 3.00 B.C. and 3) 5/16–18 x 0.62 dp 3.50 B.C.
MC6	None 1/8 Key 3/16 Key 3/16 Key 3/16 Key 1/4 Shallow	2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws	3/8 1/2 5/8 3/4 7/8 1	2.441/2.440	3) 1/4-20 x 5/16 dp 2.875 B.C.
MC6D	3/16 Key 3/16 Key 3/16 Key 1/4 Shallow	2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws	5/8 3/4 7/8 1	3.250/3.248	3) 5/16-18 x 1/2 dp 4.00 B.C.
MC9	3/16 Key 3/16 Key 3/16 Key 1/4 Key 1/4 Key 1/4 Key	2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws	5/8 3/4 7/8 1 1-1/8 1-1/4	3.250/3.248	4) 5/16–18 x 0.50 dp 5.875 B.C. and 3) 5/16-18 x 1/2 dp 4.25 B.C.

Solid Shaft Configurations

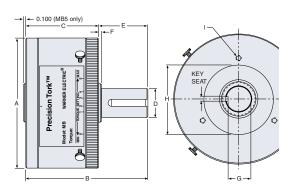

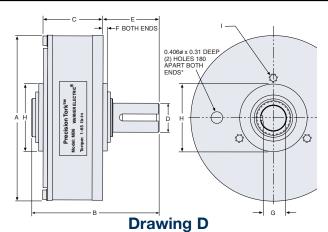

Drawing C

					y v				Diawing	9 D	
*Thumb screw adjustment								*Spanner wrench adjustment			
Drawing	Α	В	С	D (Shaft)	E	F	G	KEY SEAT	H (Pilot-Both Ends)	l (Both Ends)	
С	0.99	1.37	0.86	3/16	0.51	-	0.170 Flat	-	0.300/0.302 x 0.12 dp	3) 4-40 x 1/4 dp 0.610 B.C.	
С	1.85	2.36	1.38	1/4	.98	-	0.230 Flat	_	0.876/0.877 x 0.08 dp	3) 6-32 x 5/16 dp 1.250 B.C.	
C C	1.85 1.85	2.36 2.36	1.35 1.35	1/4 3/8	1.01 1.01	-	0.230 Flat 0.355 Flat		0.876/0.877 x 0.08 dp 0.876/0.877 x 0.08 dp	3) 6-32 x 5/16 dp 1.250 B.C. 3) 6-32 x 5/16 dp 1.250 B.C.	
C C	2.31 2.31	3.35 3.35	2.23 2.23	3/8 1/2	1.12 1.12	-	0.355 Flat 0.430/0.414	_ 0.125	1.653/1.655 x 0.10 dp 1.653/1.655 x 0.10 dp	3) 10-32 x 7/16 dp 1.875 B.C. 3) 10-32 x 7/16 dp 1.875 B.C.	
С	2.74	3.02	1.98	3/8	1.04	0.04	0.355 Flat	-	1.383/1.381 x 0.12 dp	3) 10-32 x 7/16 dp 1.875 B.C.	
C C	3.23 3.23	2.98 2.98	2.01 2.01	1/2 5/8	0.97 0.97	0.09 0.09	0.430/0.414 0.518/0.502	0.125 0.188	1.852/1.854 x 0.08dp 1.852/1.854 x 0.08dp	3) 10-32 x 7/16 dp 2.375 B.C. 3) 10-32 x 7/16 dp 2.375 B.C.	
С	4.65	4.48	2.64	1	1.75	0.12	0.860/0.844	0.250	2.441/2.440 x 0.100 dp	3) 10-32 x 1/2 dp 3.000 B.C.	
С	5.29	4.53	2.65	1	1.88	0.25	0.860/0.844	0.250	2.441/2.440 x 0.26 dp	3)10-32 x 1/2 dp 3.000 B.C. and 3) 5/16-18 x 0.62 dp 3.500 B.C.	
D	6.05	4.48	2.02	1	2.06	0.18	0.860/0.844	0.250	2.441/2.440	3) 1/4-20 x 5/16 dp 2.875 B.C.	
D	6.95	6.23	4.06	7/8	1.81	0.24	0.771/0.755	0.188	3.250/3,248	3) 5/16-18 x 1/2 dp 4.000 B.C.	
D	9.40	5.39	3.49	1	1.77	0.13	0.860/0.844	0.250	3.250/3.248	4) 5/16-18 x 1/2 dp 5.875 B.C. and 3) 5/16-18 x 1/2 dp 4.250 B.C.	
	Drawing C C C C C C C C C	Drawing A C 0.99 C 1.85 C 1.85 C 2.31 C 2.31 C 2.31 C 3.23 C 3.23 C 3.23 C 5.29 D 6.05 D 6.95	Drawing A B C 0.99 1.37 C 1.85 2.36 C 1.85 2.36 C 1.85 2.36 C 1.85 2.36 C 2.31 3.35 C 2.31 3.35 C 2.74 3.02 C 3.23 2.98 C 5.29 4.53 D 6.05 4.48 D 6.95 6.23	Nawing A B C Drawing A B C C 0.99 1.37 0.86 C 1.85 2.36 1.38 C 1.85 2.36 1.35 C 1.85 2.36 1.35 C 2.31 3.35 2.23 C 2.74 3.02 1.98 C 3.23 2.98 2.01 C 5.29 4.48 2.02 D 6.05 4.48 2.02 D 6.05 6.23 4.06	*Thumb screwadjustnew Drawing A B C Date of the screen sc	Drawing A B C D Image: Second seco	*Thumb screw adjustment Drawing A B C D E F C 0.99 1.37 0.86 3/16 0.51 - C 1.85 2.36 1.38 1/4 .98 - C 1.85 2.36 1.38 1/4 .98 - C 1.85 2.36 1.35 1/4 1.01 - C 1.85 2.36 1.35 3/8 1.01 - C 2.31 3.35 2.23 3/8 1.12 - C 2.31 3.35 2.23 1/2 1.12 - C 2.31 3.35 2.23 1/2 1.12 - C 2.31 3.35 2.23 1/2 1.12 - C 3.23 2.98 2.01 1/2 0.97 0.09 C 3.23 2.98 2.01 5/8 0.97 0.09 C 5.29 4.53 2.65 1 1.88 0.25	*Thumb screw adjustment Drawing A B C D E F G C 0.99 1.37 0.86 3/16 0.51 - 0.170 Flat C 1.85 2.36 1.38 1/4 .98 - 0.230 Flat C 1.85 2.36 1.35 1/4 1.01 - 0.230 Flat C 1.85 2.36 1.35 1/4 1.01 - 0.230 Flat C 1.85 2.36 1.35 1/4 1.01 - 0.230 Flat C 2.31 3.35 2.23 3/8 1.12 - 0.355 Flat C 2.31 3.35 2.23 1/2 1.12 - 0.430/0.414 C 3.23 2.98 2.01 1/2 0.97 0.09 0.430/0.414 C 3.23 2.98 2.01 1/2 0.97 0.09 0.518/0.502 C 4.65	**Spanne Drawing A B C Dawing (shaft) F F G KEY sear C 0.99 1.37 0.86 3/16 0.51 - 0.170 Flat - C 1.85 2.36 1.38 1/4 .98 - 0.230 Flat - C 1.85 2.36 1.35 1/4 1.01 - 0.230 Flat - C 1.85 2.36 1.35 3/8 1.01 - 0.230 Flat - C 1.85 2.36 1.35 3/8 1.01 - 0.355 Flat - C 2.31 3.35 2.23 3/8 1.12 - 0.430/0.414 0.125 C 2.31 3.35 2.23 1/2 1.12 - 0.430/0.414 0.125 C 3.23 2.98 2.01 1/2 0.97 0.09 0.430/0.414 0.1250 C 3.23 <td>*Thumb screw adjustment *Spanner wrench adjustment Drawing A B C D Shaft F G KEY SEAT (Pilot-Both Ends) C 0.99 1.37 0.86 3/16 0.51 - 0.170 Flat - 0.300/0.302 x 0.12 dp C 1.85 2.36 1.38 1/4 .98 - 0.230 Flat - 0.876/0.877 x 0.08 dp C 1.85 2.36 1.35 1/4 1.01 - 0.230 Flat - 0.876/0.877 x 0.08 dp C 1.85 2.36 1.35 3/8 1.01 - 0.230 Flat - 0.876/0.877 x 0.08 dp C 1.85 2.36 1.35 3/8 1.01 - 0.355 Flat - 0.876/0.877 x 0.08 dp C 2.31 3.35 2.23 3/8 1.12 - 0.430/0.414 0.125 1.653/1.655 x 0.10 dp C 2.31 3.23 2.98 2.01 1/2 0.97 0.09</td>	*Thumb screw adjustment *Spanner wrench adjustment Drawing A B C D Shaft F G KEY SEAT (Pilot-Both Ends) C 0.99 1.37 0.86 3/16 0.51 - 0.170 Flat - 0.300/0.302 x 0.12 dp C 1.85 2.36 1.38 1/4 .98 - 0.230 Flat - 0.876/0.877 x 0.08 dp C 1.85 2.36 1.35 1/4 1.01 - 0.230 Flat - 0.876/0.877 x 0.08 dp C 1.85 2.36 1.35 3/8 1.01 - 0.230 Flat - 0.876/0.877 x 0.08 dp C 1.85 2.36 1.35 3/8 1.01 - 0.355 Flat - 0.876/0.877 x 0.08 dp C 2.31 3.35 2.23 3/8 1.12 - 0.430/0.414 0.125 1.653/1.655 x 0.10 dp C 2.31 3.23 2.98 2.01 1/2 0.97 0.09	

Fixed End Cap Ĕ ٦ н Clearance for 1/4" bolts Ø. ¥ ĪC Ď G

Optional Mounting Bracket

Note: Mount bracket to fixed end cap - side opposite knurled adjustment ring.

				• •		-	-			
Model	Fits Size	Α	В	C	D	E	F	G	Н	I
MPB-2B	MB1.5, 2	0.270	1.750	1.155	0.390	0.280	2.500	0.755	1.500	3.000
(MPB-2BM)	MC1.5, 2	(6.9)	(44.5)	(29.3)	(9.9)	(7.1)	(63.5)	(19.2)	(38.1)	(76.2)
MPB-15B	MB2.5/MC2.5, 3, 4	0.270	2.500	1.155	0.390	0.280	3.500	1.130	2.000	4.000
MPB-15BM)	MB4/MC4, 3, 4	(6.9)	(63.5)	(29.3)	(9.9)	(7.1)	(88.9)	(28.7)	(50.8)	(101.6)
MPB-70B	MB5/	0.270	4.875	1.155	0.390	0.280	6.000	1.630	3.500	6.000
MPB-70BM)	MC5	(6.9)	(123.8)	(29.3)	(9.9)	(7.1)	(152.4)	(41.4)	(88.9)	(152.4)
MPB-120B	MB5.5	0.270	4.875	1.155	0.390	0.280	6.000	1.630	3.500	6.250
MPB-120BM)	MC5.5	(6.9)	(123.8)	(29.3)	(9.9)	(7.1)	(152.4)	(41.4)	(88.9)	(158.8)
MPB-240B	MB6	0.270	4.875	1.155	0.390	0.280	6.500	2.445	4.000	7.500
(MPB-240BM)	MC6	(6.9)	(123.8)	(29.3)	(9.9)	(7.1)	(165.1)	(62.1)	(101.6)	(190.5)


All dimensions are nominal unless otherwise noted. () denotes (mm)

All Brackets are 12 gauge (.105") Steel


1

↑ H 6 -0


Heat Dissipation Charts

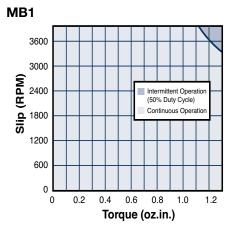




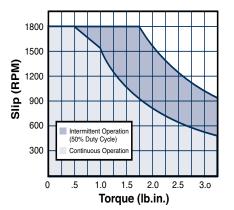


MC5/MB5

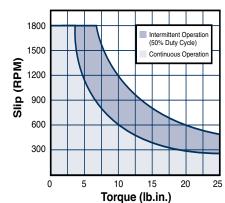


MC6D/MB6D

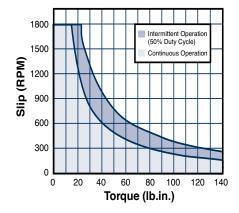

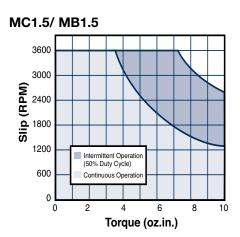

MC3/MB3

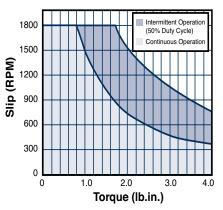


Intermittent Operatio (50% Duty Cycle)


Continuous Operati

45


MC2/MB2

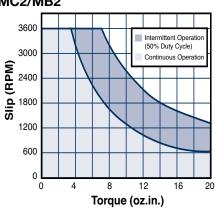

MC4/MB4

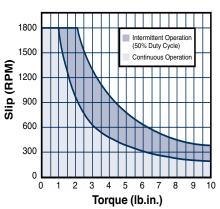

MC6/MB6

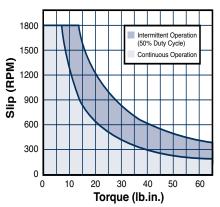



MC5.5/MB5.5

1800

1500

1200

900

600


300

0

0


5 10 15 20 25 30 35 40

Slip (RPM)

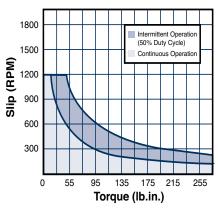


Torque (lb.in.)

Torque Setting Charts

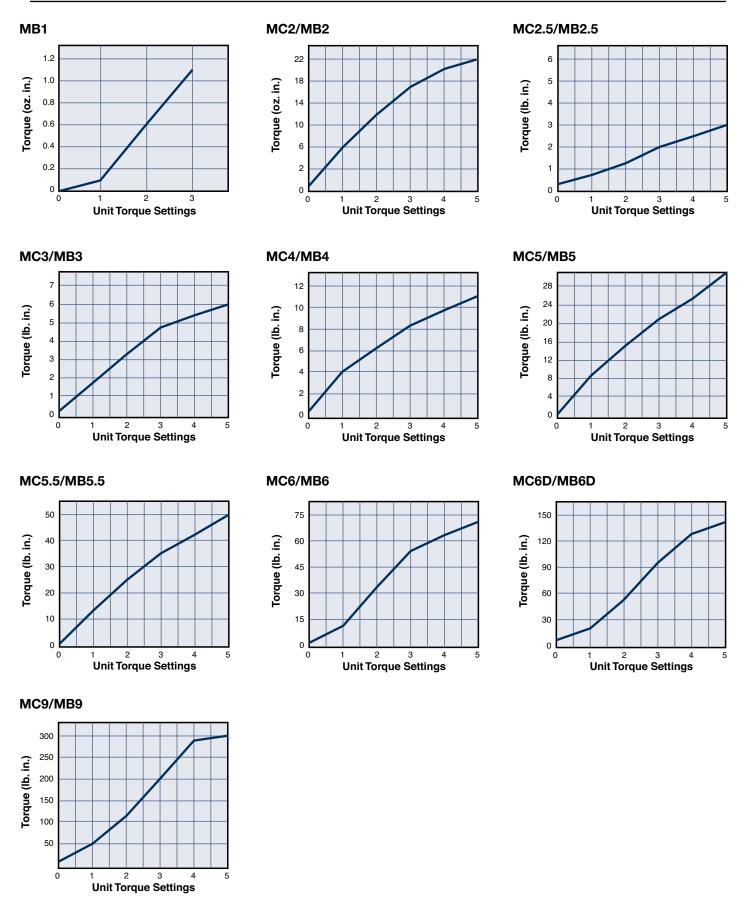

*Torque values are approximate.

Stub Shaft Adapters

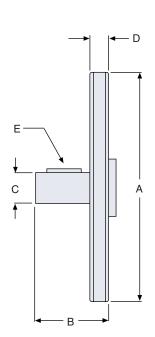



- Utilized when "clutch coupling" configuration is desired.
- Comes complete with attachment hardware and drive key.
- Stub shaft adapters should be used in conjunction with a flexible coupling.
- Also available in Stainless Steel.

Adapter Size	Permanent Magnet Model	Α	В	С	D	E
A1-3/16	MB1	0.9	0.88	3/16	0.18	Flat
A2-14	MB1.5/MC1.5/MB2/MC2	1.60	0.78	1/4	0.15	Flat
A2-58	MB1.5/MC1.5/MB2/MC2	1.60	1.15	5/8	0.15	3/16" Key
A3-38	MB3/MC3	2.36	1.19	3/8	0.19	Flat
A4-38	MB4/MC4	2.86	1.19	3/8	0.19	Flat
A4-58	MB4/MC4	2.86	1.19	5/8	0.19	3/16" Key
A5-1	MB5/MC5/MB5.5/MC5.5	3.45	1.72	1	0.27	1/4" Key
A5-12	MB5/MC5/MB5.5/MC5.5	3.45	1.47	1/2	0.27	1/8" Key
A6-34	MB6/MC6	3.40	1.70	3/4	0.35	3/16" Key
A6D-34	MB6D/MC6D/MB9/MC9	4.65	2.50	3/4	0.50	3/16" Key

*If Solid Shaft Series is used with adapter, thumb screw must be removed and replaced with set screws.

How to Order

1. Torque:

Determine the maximum torque that your application requires. See the application example.

2. Energy Dissipation:

Determine the amount of energy or heat that will be generated during operation. Each clutch or brake is rated for a specific amount of energy, given in units of watts, that it can safely dissipate. Energy calculations for common applications are listed in the applications section.

3. Model Selection:

Select the clutch or brake based on torque and energy requirements. See the specifications under "Heat Dissipation and Torque Setting Charts."

4. Select Bore Size:

Select the proper bore size for the application. Although many standard bores are available, consult the factory if your bore requirement is not listed.

5. Example:

Torque Requirement – 9 lb.in. Energy Requirement – 35 watts Bore Requirement – 5/8 inch Select Model MC5-58

Application Notes

Magnetic Particle Clutches and Brakes

Accurate torque control with instantaneous engagement!

Warner Electric Precision Tork magnetic particle clutches and brakes are unique because of the wide operating torque range available. Torque to current is almost linear and can be controlled very accurately. The unique features of the magnetic particle clutches and brakes make them ideal for tension control, load simulation, cycling/indexing, and soft starts and stops.

Specials are our business

Special Shaft Configurations

Customer specified shaft configurations for easy machine mounting and retrofitting.

Special Torque

Maximum torque configurations to meet customer specifications.

Special Mounting Configurations

Customer specified bolt patterns, special mounting brackets.

Metric units

Features and Benefits

Torque independent of slip speed

Torque is transmitted through magnetic particle chains which are formed by an electromagnetic field. The torque is independent of slip speed, depending only on circuit current, and is infinitely variable from 0 (disengaged) to rated torque.

• Precise engagement

Precision Tork magnetic particle clutches and brakes engage to transmit torque with speed and precision. Response of the particles to the field is virtually instantaneous, providing perfectly controlled, jerk-free engagement.

Customer specified engagement

Engagement time may be very gradual or extremely fast. The frequency and torque of the engagement/disengagement sequence is limited only by the capabilities of the control circuitry.

• No wearing parts

6

There are no friction surfaces to grab or wear, and the units are not affected by changes in atmospheric or other environmental conditions.

• Efficient/Compact design

High torque to size ratio and low consumption of electric power.

Versatile mounting


Convenient bolt circle for easy mounting. Mounting brackets available for all sizes. Brakes are available with solid shafts and through bore. Can be mounted horizontally or vertically to solve virtually any motion control requirement.

Distributor Item

Off the shelf availability. Interchangeable with industry standard sizes.


Design and Operation

The inside story.

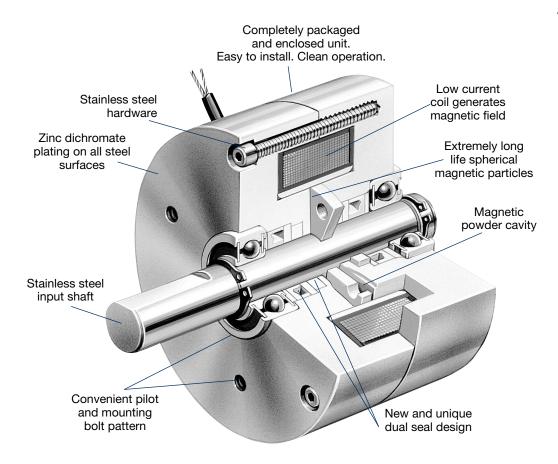

Operating Principles

The magnetic particle unit consists of four main components: 1) housing; 2) shaft/disc; 3) coil and 4) magnetic powder. The coil is assembled inside the housing. The shaft/disc fits inside the housing/coil assembly with an air gap between the two; the air gap is filled with fine magnetic powder.

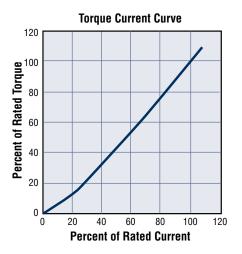

Engagement


When DC current is applied to the magnetic particle unit, a magnetic flux (chain) is formed, linking the shaft/ disc to the housing. As the current is increased the magnetic flux becomes stronger, increasing the torque. The magnetic flux creates extremely smooth torque and virtually no "stick-slip".

Disengagement

When DC current is removed the magnetic powder is free to move within the cavity, allowing the input shaft to rotate freely.

Cycling

By turning the current to the coil on and off a cycling effect is achieved.

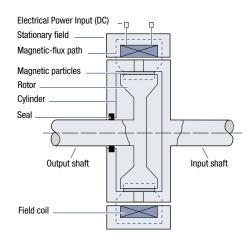

Sizing

To properly size magnetic particle clutches or brakes the thermal energy (slip watts) and torque transmitted must be considered. If thermal energy and torque are known for the application select the unit from the charts to the right.

RPM

RPM must be known when calculating thermal energy (slip watts). For load simulation, torque limiting and similar applications, RPM is known. For web handling, the RPM is calculated as follows:

Slip RPM^{*} = $\frac{12 \text{ x Velocity (feet per min.)}}{\pi \text{ x Full Roll Dia.}^{**} (in.)}$

*In rewind applications the motor RPM should be higher (10%) than the fastest spool RPM. **In applications with the web running over a pulley

or in a nip roll application use the pulley diameter as the roll diameter.

Thermal Energy (slip watts)

Tension applications are considered continuous slip applications. When a brake or clutch is slipping, heat is generated. Heat is described in terms of "energy rate" and is a function of speed, inertia, and cycle rate. Heat generated is usually described in terms of thermal energy or slip watts. Starting and stopping applications generate heat when the unit slips during the stopping and starting of the load.

• For continuous slip applications, such as tension control in an unwind or rewind application slip watts are calculated using the following formula:

Slip Watts = .0118 x Torque (lb.in.) x Slip RPM

• For cycling applications heat is generated intermittently, and is calculated using the following formula:


Watts =
$$2.67 \times \text{Inertia (lb.in.}^2)$$


 $\times \left(\frac{\text{RPM}^2}{10,000} \right) \times \text{F} \frac{\text{cycle}}{\text{min.}}$


Duty Cycle

The average heat input must be below the clutch or brake's heat dissipation rating. If the application generates intermittent heat dissipation, use the average speed for the thermal energy (slip watts) calculations.

Quick Selection Charts

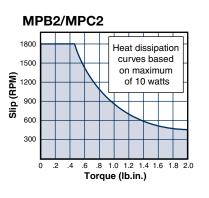

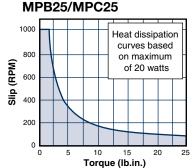

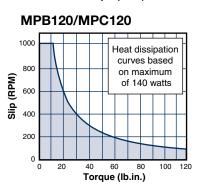


Torque

Tension applications calculate torque as a function of roll radius and tension. Soft/controlled stopping applications calculate torque as a function of inertia, speed and desired time to stop the load. Torque limiting applications calculate torque as the allowable drive through torque. Calculate the torque requirement based on the formulas for the different applications:


• To calculate torque for a web handling application, determine the desired tension in the web then calculate the required torque as follows:

Torque (lb.in.) =


MPB15/MPC15

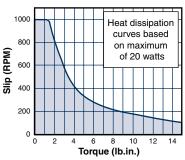

MPB70/MPC70

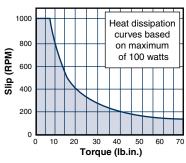

MPB240

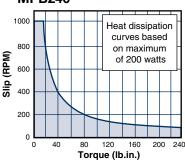

*Use full roll diameter. In applications with the web running over a pulley or in a nip roll application use the pulley diameter as the roll diameter.

• To calculate torque for soft/controlled stop or cycling applications first determine the inertia (WR²), and apply it to the formula below:


Torque (lb.in.) =
$$\frac{\text{Inertia (lb.in.}^2) \times \text{RPM}}{3,690 \times \text{time(s)}}$$

Inertia (WR²) =

[(weight of body) x (radius of gyration*)]²

*to calculate for a cylinder about its axis: Solid cylinder = $R^2 = 1/2r^2$ Hollow cylinder = $R^2 = 1/2(r_1^2+r_2^2)$

Selection

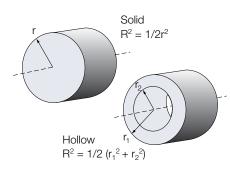

Reflected Inertia (rotational)

In mechanical systems it is common for the rotating parts to operate at different speeds. In clutch and brake applications the WR² is calculated for each part operating at different speeds then reduced to and equivalent WR² at the clutch or brake mounting shaft speed. All the rotating parts' WR² are added together and treated as a unit.

The formula for determining the equivalent WR² of a rotating part referred to the clutch or brake shaft is as follows:

$$WR_{e^{2}} = WR^{2} \times \left(\frac{N}{Ncb}\right)^{2}$$

Where:

WR² = inertia of the rotating part at N (RPM)

$$N =$$
 speed (RPM) of the rotating part
Nob = speed (RPM) of the clutch or

⁴cb brake shaft

Reflected Inertia (linear)

In complex systems involving both linear and rotating motion, the linearly moving parts can be reduced to the clutch or brake speed by the following equation:

WR²e = W x
$$\sqrt{\frac{2\pi N}{2\pi N}}$$

Where:

W = Weight of body

V = Velocity in feet per minute

N = RPM of the clutch or brake shaft

This equation can only be used when the linear speed has a continuous fixed relation to the rotating speed, such as a conveyor driven by a motor.

To determine torque in an overload protection, torque limiting or soft start application use the following equation:

HP x 63,000 Torque (lb.in.) = **RPM**

Tension Value Chart

Material	tn (lbs.in.
	of web width)
Aluminum foils	0.5 to 1.5
o	(1.0 aver.)/mil
Cellophanes	0.5 to 1.0/mil
Acetate	0.5/mil
Mylar (Polyester)	0.25 to 0.30/mil
Polyethylene	0.25 to 0.30/mil
Polypropylene	0.25 to 0.30/mil
Polystyrene	1.0/mil
Saran	0.05 to 0.20
Vinyl	(0.10 aver.)/mil 0.05 to 0.20
VILTYI	(0.10 aver.)/mil
	(0.10 aver.)/111
Paper and Laminations	
20#/R-32.54 gm/m ²	0.50 to 1.0
40#/R-65.08 gm/m ²	1.0 to 2.0
60#/R—97.62 gm/m ²	1.5 to 3.0
80#/R—130.0 gm/m ²	2.0 to 4.0
Paper	
15 lbs./ream (3,000 sq. ft.)	0.5
20 lbs./ream	0.75
30 lbs./ream	1.0
40 lbs./ream	1.5
80 lbs./ream	2.5
Laminations	
25 lb. paper/.005"	
PE/.00032" FOIL/.001" PI	E 3.0
.001" Cello/.0005" PT/.00	
Cello	1.5
When these substrates ar	
polyethylene, nylon polypi	
EAA, and EEA, add the fo	llowing tension to
the values listed above for	
Coating Thickness	
Coating Thickness 0.0005" to 0.0001	0.12
0.0011" to 0.002	0.25
0.0011 10 0.002	0.20

Calculating Web Tension

For sizing brakes on applications in which the applied web tension is unknown, use the following information to determine the approximate tension value.

Applied Web Tension (lbs.) = Approx. Material Tension (lb.in.)

x Roll Width (in.)

Example:

The tension for a twelve inch wide roll of 20# paper stock is unknown. What is the prescribed tension?

Material	tn (lbs.in. of web width)
Cellophane	
.00075"	0.5
.001"	0.75
.002"	1.0
Nylon and Cast P (non-Oriented)	ropylene
.00075"	0.15
.001"	0.25
.002"	0.5
Paperboard	
8 pt.	3.0
12 pt.	4.0
15 pt.	5.0
20 pt.	7.0
25 pt.	9.0
30 pt.	11.0
Mylar and Oriente	ed Propylene
0.0005"	0.25
0.001"	0.5
0.002"	1.0
Material	tn (lbs./strand)
Aluminum Wire	
#20 AWG	4.00
#18 AWG	5.50
#16 AWG	9.00
#14 AWG	10.00
#12 AWG	12.00
#10 AWG	15.00
#8 AWG	25.00
Copper Wire	
#20 AWG	8.00
#18 AWG	10.00
#16 AWG	12.00
#14 AWG	15.00
	18.00
#12 AWG	
#12 AWG #10 AWG #8 AWG	20.00

Solution:

The approximate tension value as noted in the chart above for 20# paper stock is 0.75 lb.in.; thus the tension for this application is (0.75 lb.in. x 12) = 9 lbs.


Applications

Warner Electric Precision Tork magnetic particle clutches and brakes are the ideal solution for controlling and maintaining torque. If the application is tensioning, load simulation, torque limiting, or soft starts and stops the magnetic particle unit is the preferred torque controlling device.

Typical Applications

- Wire Processing (winding, hooking, cutting)
- Paper/Foil/Film Processing
- Labeling Applications
- Textile Processing
- Material Processing
- Load profile simulation on:
 - Exercise Equipment
 - Flight Simulators
- Healthcare Equipment
- Life testing on:
 - Motors
- Gears
- Pulleys
- Belts
- Chains
- Many other Rotating Devices
- Conveyors
- Bottle Capping

Controlled Acceleration/Deceleration

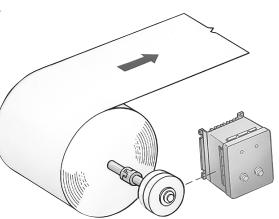

Controlled soft stop

Particle brakes and the MCS-153 control provide soft stopping of large rotating loads. By controlling the input current, the load is decelerated in a controlled manner without torque spikes, shock, or vibration.

Application Example:

Information Required:							
RPM: 1,000							
Time to Stop:	3 seconds						
Inertia*:	400 lb.in. ²						

*If inertia is not known see page 3 to calculate.

How to Size:

Maximum Torque (lb.in.) =

$$= \frac{\text{Inertia (lb.in.2) x RPM}}{3,690 \text{ x time(s)}}$$

$$= \frac{400 \times 1,000}{3,690 \times 3}$$

= 36 lb-in

Select a brake that exceeds the maximum torque requirements from the Specification Chart – MPB70.

Controlled soft start

Particle clutches and the MCS-153 control provide soft controlled acceleration to prevent tipping or shock during start up.

Application Example:

Information Required: RPM: 500 Time to Start: 4 sec. Inertia*: 50 lb.in.²

*If inertia is not known see page 3 to calculate

How to Size:

Maximum Torque (lb.in.) =

$$= \frac{\text{Inertia (lb.in.2) x RPM}}{3,690 \text{ x time(s)}}$$

50 x 500

- 3,690 x 4
- = 1.7 lb.in.

Select a clutch that exceeds the maximum torque requirements from the Specification Chart – MPC2.



Tensioning

Magnetic Particle clutches and brakes offer smooth controlled torque for tensioning in both the unwind zone and rewind zone. Torque produced from the magnetic particle clutches and brakes is independent of slip speed, offering a distinct advantage over competing technologies. Since torque can be varied infinitely by varying the input current, the magnetic particle clutches and brakes are ideal in an open loop system. To close the loop in the

tensioning system, combine the magnetic particle clutch or brake with a Warner® sensor and control, resulting in more precise control of tension.

0

Unwind stand under load cell control

Particle brakes and the TCS-240 load cell control with precision load cell sensors provide closed loop tension control.

Application Example:

Information Required:								
Full Roll Diameter: 20 inches								
Tension:	5 lbs.							
Velocity:	400 fpm							

How to Size:

Maximum Torque (lb.in.) = Full roll diameter (in.) x tension (lbs.) 2 20 x 5 2 100 2

= 50 lb.in.

Slip RPM = $\frac{\text{Velocity (fpm) x 12}}{\text{Full roll diameter x }\pi}$
Full roll diameter x π
400 x 12
$=$ $\frac{20 \times \pi}{20 \times \pi}$
= 76 RPM

Thermal Energy (Slip Watts) = .0118 x Torque (lb.in.) x RPM = .0118 x 50 x 76

= 45 Watts

Select a brake that exceeds the maximum torgue and thermal energy requirements from Quick Selection Chart - MPB70.

Rewind stand under dancer control

Particle clutches and the MCS-203 control provide accurate closed loop tension control for rewind applications.

Application Examp	ole:
Information Require Core Diameter:	ed:
Full Roll Diameter:	3 inches 9 inches
Tension:	5 lbs.
Velocity:	300 fpm
Input RPM:	500 RPM*
Maximum Torque (I tension (Ibs.)	b.in.) = x full roll diameter (in.)
	2
$=\frac{5 \times 9}{2}$	
= 23 lb-in	
Core RPM = $\frac{12 \times V}{\pi \times (cc)}$	'elocity (fpm) pre diameter)
$=\frac{12\times30}{\pi\times3}$	0
= 382 RP	М
Full Roll RPM = $\frac{12}{\pi}$	x Velocity (fpm) x Full Roll Dia.
$=\frac{12\times30}{\pi\times9}$	0
= 127 RP	М
Slip RPM = Input R	PM – Full Roll RPM
= 500 - 1	27
= 372.68	
Thermal Energy (sli	p watts) =
= .0118 x	Torque x Slip RPM
= .0118 x	22 x 373
= 99 wat	S
Soloot a clutch that	overede the

Select a clutch that exceeds the maximum torgue and thermal energy requirements from the Quick Selection Chart - MPC120.

*To maximize tension control and minimize heat generated, select a drive system that will result in an actual input speed as close to, but not less than, 30 RPM greater than the core RPM. In this example, 382 + 30 = 412, would be ideal but 500 RPM was more readily available.

Torque Limiting/ Overload Protection

The magnetic particle clutches and brakes combined with a Warner[®] CBC control are effective means to providing protection in the case of jam ups. The magnetic particle clutch and the CBC control can provide precise adjustable torque in torque limiting applications.

Application Example

Information Required: Motor HP: 1 HP Motor RPM : 700 RPM

How to Size:

Maximum Torque (lb.in.) =


- = HP x 63,000 RPM _ 1 x 63,000
- 700
- = 90 lb.in.

Select a clutch that exceeds the maximum torque requirements from the Selection Chart – MPC120.




By combining the magnetic particle brake with a microprocessor control, virtually any load simulation can be obtained. The control is programmed with the profile or condition that is to be simulated. The control then feeds the profile to the magnetic particle brake in terms of input current. The brake reads the input current and provides load torque to simulate the condition.

If the application requires programming load profiles, adjusting load torque, or simulating friction or drag loads, the magnetic particle clutches and brakes are the ideal solution.

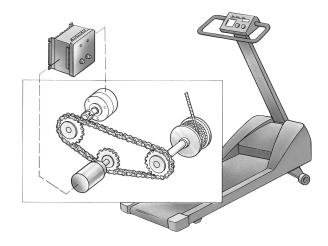


Exercise Equipment

Brake models provide a smooth controllable resistance for exercise machines. When integrated with a microprocessor control, programming load profiles is possible.

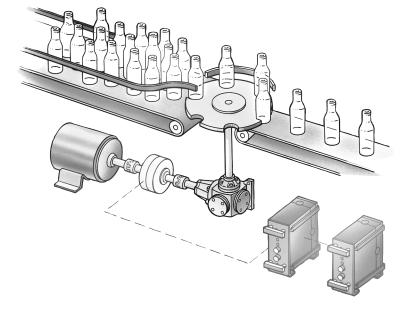

Dimensions and Specifications

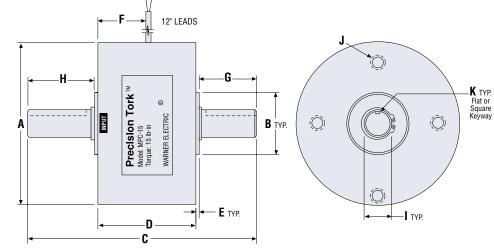

Dimensions


Clutches

Model	Α	В	C	D	E	F	G (Output)	H (Input)	I	J	K5
MPC2-1	2.11	0.750/0.749	3.73	1.85	0.06	1.16	0.88	0.88	0.2498/0.2492	(3) #6-32 x 0.50 on 1.350 BC	Flat
MPC15-1	2.96	1.125/1.124	4.93	2.80	0.07	1.69	1.00	1.00	0.4998/0.4992	(3) #8-32 x 0.50 on 2.000 BC	Flat
MPC15-2	2.96	1.125/1.124	5.08	2.80	0.07	1.69	1.22	0.92	0.3748/0.3742	(3) #8-32 x 0.50 on 2.000 BC	Flat
MPC25-1	2.96	1.125/1.124	4.93	2.80	0.07	1.69	0.995	1.00	0.4998/0.4992	(3) #8-32 x 0.50 on 2.000 BC	2 Flats at 90°
MPC25-2	2.96	1.125/1.124	5.08	2.80	0.07	1.69	1.22	0.92	0.3748/0.3742	(3) #8-32 x 0.50 on 2.000 BC	2 Flats at 90°
MPC70	4.58	1.625/1.624	6.55	3.67	0.10	2.08	1.35	1.35	0.7497/0.7492	(4) #10-32 x 0.63 on 4.228 BC	0.188 Keyway
MPC120	5.25	1.625/1.624	7.02	4.00	0.10	2.40	1.50	1.35	0.7497/0.7492	(4) #1/4-20 x 0.75 on 4.812 BC	0.188 Keyway

Specifications

Model Number	Max. Drag Torque O Excit. (Ib.in.)	Rated Torque (Ib.in.)	Rated Voltage	Resistance (Ohms)	Rated Current (Amps)	Response Zero Force (Millisec)	Response With Force (Millisecs)	Inertia of Output Shaft (Ib.in.2)	Max. Heat Dissipation (watts)	Max. Speed Recom. (RPM)	Weight
MPC2	0.40	2	24	92	0.261	8	4	0.001	10	1,800	2
	0.40	2	90	1552	0.058	8	4	0.001	10	1,800	2
MPC15	0.40	15	24	80	0.302	25	9	0.013	20	1,000	5.5
	0.40	15	90	1501	0.060	25	9	0.013	20	1,000	5.5
MPC25	0.40	25	24	45	0.533	25	9	0.013	20	1,000	5.5
MPC70	1.00	70	24	35	0.677	70	17	0.073	100	1,000	16
	1.00	70	90	613	0.147	70	17	0.073	100	1,000	16
MPC120	2.00	120	24	33	0.742	90	25	0.370	140	1,000	22
	2.00	120	90	475	0.190	90	25	0.370	140	1,000	22

Optional Mounting Bracket (for mounting MPB Brakes and MPC Clutches)

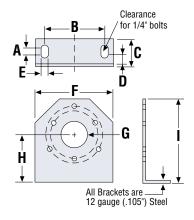



Model	Fits Size	Α	В	C	D	Е	F	G	H	I
MPB-2B	2	0.270 (6.9)	1.750 (44.5)	1.155 (29.3)	0.390 (9.9)	0.280 (7.1)	2.500 (63.5)	0.755 (19.2)	1.500 (38.1)	3.000 (76.2)
MPB-15B	15, 25	0.270 (6.9)	2.500 (63.5)	1.155 (29.3)	0.390 (9.9)	0.280 (7.1)	3.500 (88.9)	1.13 (28.7)	2.000 (50.8)	4.000 (101.6)
MPB-70B	70	0.270 (6.9)	4.875 (123.8)	1.155 (29.3)	0.390 (9.9)	0.280 (7.1)	6.000 (152.4)	1.63 (41.4)	3.500 (88.9)	6.000 (152.4)
MPB-120B	120	0.270 (6.9)	4.875 (123.8)	1.155 (29.3)	0.390 (9.9)	0.280 (7.1)	6.000 (152.4)	1.63 (41.4)	3.500 (88.9)	6.250 (158.8)
MPB-240B	240	0.270 (6.9)	4.875 (123.8)	1.155 (29.3)	0.390 (9.9)	0.280 (7.1)	6.500 (165.1)	2.245 (62.1)	4.000 (101.6)	7.500 (190.5)

All dimensions are nominal unless otherwise noted. () denotes (mm)

Dimensions and Specifications

Brakes

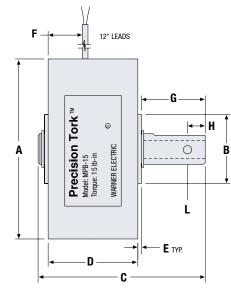

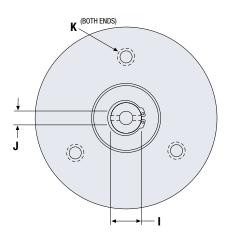

Dimensions

Model	Α	В	C	D	E	F	G	Н	I (Shaft)	J (Bore)	К	L
MPB2-1	2.11	0.750/0.749	2.23	1.15	0.06	0.70	0.87	-	0.2498/0.2492	-	(3) #6-32 x 0.27 on 1.350 BC	1 Flat
MPB15-1	2.96	1.125/1.124	3.05	1.46	0.07	0.85	1.35	-	0.3748/0.3742	-	(3) #8-32 x 0.30 on 2.000 BC	2 Flats at 90°
MPB15-2	2.96	1.125/1.124	2.05	1.46	0.07	0.85	0.34	0.18	-	0.375/0.376	(3) #8-32 x 0.30 on 2.000 BC	0.125 Thru Hole
MPB15-3	2.96	1.125/1.124	2.70	1.46	0.07	0.85	0.99	-	0.4998/0.4992	_	(3) #8-32 x 0.30 on 2.000 BC	2 Flats at 90°
MPB25-1	2.96	1.125/1.124	2.05	1.46	0.07	0.85	1.35	-	0.3748/0.3742	-	(3) #8-32 x 0.30 on 2.000 BC	2 Flats at 90°
MPB25-2	2.96	1.125/1.124	2.05	1.46	0.07	0.85	0.34	0.18	_	0.375/0.376	(3) #8-32 x 0.30 on 2.000 BC	0.125 Thru Hole
MPB25-3	2.96	1.125/1.124	2.7	1.46	0.07	0.85	0.99	-	0.4998/0.4992	_	(3) #8-32 x 0.30 on 2.000 BC	2 Flats at 90°
MPB70-1	4.57	1.625/1.624	2.62	1.76	0.10	0.98	0.50	0.18	-	0.500/0.501	(4) #10-32 x 0.50 on 4.228 BC	0.125 Thru Hole
MPB70-2	4.57	1.625/1.624	3.37	1.76	0.10	0.98	1.25	-	0.7497/0.7492	-	(4) #10-32 x 0.50 on 4.228 BC	0.188 Keyway
MPB120-1	5.25	1.625/1.624	4.02	2.17	0.10	1.18	1.50	0.50	_	0.500/0.501	(4) #1/4-20 x 0.75 on 4.812 BC	0.156 Thru Hole
MPB120-2	5.25	1.625/1.624	4.02	2.17	0.10	1.18	1.50	-	0.7497/0.7492	-	(4) #1/4-20 x 0.75 on 4.812 BC	0.188 Keyway
MPB240-1	6.23	2.442/2.440	4.66	2.65	0.10	1.46	1.65	-	0.7497/0.7492	_	(4) #1/4-20 x 0.65 on 5.875 BC	0.188 Keyway
MPB240-2	6.23	2.442/2.440	3.51	2.65	0.10	1.46	0.50	-	_	0.875/0.876	(4) #1/4-20 x 0.65 on 5.875 BC	0.188 Keyway
MPB240-3	6.23	2.442/2.440	3.51	2.65	0.10	1.46	0.50	-	-	1.000/1.001	(4) #1/4-20 x 0.65 on 5.875 BC	0.250 Shallow Keyway

Specifications

Model Number	Max. Drag Torque O Excit. (Ib.in.)	Rated Torque (Ib.in.)	Rated Voltage	Resistance (Ohms)	Rated Current (Amps)	Response Zero Force (Millisec)	Response With Force (Millisecs)	Inertia of Output Shaft (Ib.in.2)	Max. Heat Dissipation (watts)	Max. Speed Recom. (RPM)	Weight
MPB2	0.40	2	24	92	0.261	8	4	0.001	10	1,800	1
	0.40	2	90	1552	0.058	8	4	0.001	10	1,800	1
MPB15	0.40	15	24	80	0.302	25	9	0.013	20	1,000	2.5
	0.40	15	90	1501	0.060	25	9	0.013	20	1,000	2.5
MPB25	0.40	25	24	45	0.533	25	9	0.013	20	1,000	2.5
MPB70	1.00	70	24	35	0.677	70	17	0.073	100	1,000	8
	1.00	70	90	613	0.147	70	17	0.073	100	1,000	8
MPB120	2.00	120	24	33	0.742	90	25	0.370	140	1,000	12.5
	2.00	120	90	475	0.190	90	25	0.370	140	1,000	12.5
MPB240	4.00	240	24	19	1.286	150	45	1.311	200	1,000	20.5
	4.00	240	90	246	0.366	150	45	1.311	200	1,000	20.5

Controls

Adjustable Torque



TCS-200-1 Manual/Analog

The TCS-200-1/-1H single channel controls are selectable voltage or current controlled power supplies designed to power up to a 16-magnet Electro Disc tension brake system, Electromagnetic Particle Brakes, TB Series brakes, or Advanced Technology tension brakes. These controls operate from a switch-selectable power source of 115 or 230 VAC. They can be operated manually from the front panel or remotely via an analog voltage input, a current input, a remote pot, or a roll follower. External inputs are also provided for remote brake Off, Run, and Stop functions, as well as front panel control of these functions.

System Control





CBC200/CBC300

The CBC 200 and CBC 300 are Constant Current controls for 90 volt coil clutches and brakes. Both can control a single clutch or brake, or a clutch and brake or two clutches or two brakes.

Both operate based on 120 volt AC input. The CBC 200s have one output channel adjustable and one fixed. The CBC 300s have both channels adjustable.

The CBC 200 and CBC 300 provide for potentiometer adjustment on the front of the unit as shown.

The CBC 200-1 and CBC 300-1 provides for input from an external 10K ohm, 2 watt potentiometer.

The CBC 200 C1 and CBC 300 C1 are chassis mount versions of the CBC 200-1 and CBC 300-1.

Features

- Input: 115/230 VAC, 50/60 Hz
- Output: -1, 0–24 VDC adjustable, 4.25 Amps continuous
 -1H, 0–24 VDC adjustable, 5.8 Amps continuous
- Front panel torque adjust
- Front panel brake mode stop switch Modes: Stop – Brake Full On Run – Normal Operation Off – Brake Off
- Remote brake mode switch (same functions as mentioned above)
- Remote torque adjust
- Roll follower input
- 0–10 VDC analog voltage input
- 4–20mA analog current input

Features

- Input: 115 VAC 50/60 hz
- Output: Pulse width modulated full wave rectified DC. Constant current, switch selectable ranges designed for 90 volt DC clutches and brakes.
- Circuit Protection: Internal short circuit protection on outputs, but no circuit protection for AC ground faults. Customer supplied 1.5 amps 250 VAC Fast Acting type fuse recommended.
- Status Indicators: "POWER" green LED indicating AC power is applied to the control. "SHORT" red LED indicating that a short circuit condition exists on one or both of the outputs.
- Enclosure: NEMA 1 rated.
- External switching: Mechanical or Electromechanical switching. Customer supplied 1 amp, 125 v minimum rating

Dancer/Remote Analog Control



MCS-203/MCS-204/ MCS-166

The MCS-203 is a basic dancer control that automatically controls web tension through the use of a dancer roll and sensor. It is single channel, but can operate two 24 VDC tension brakes in parallel when using two MCS-166 power supplies.

The MCS-204 is a basic remote analog control that can also be operated manually via a front panel tension adjustment potentiometer. It is also single channel with the possibility of operating two 24 VDC tension brakes in parallel when using two MCS-166 power supplies.

Features

- Input: 115/230 VAC, 50/60 Hz
- Output: 0–24 VDC at 3 Amps max. MCS-203 (only)
- Full P-I-D adjustment
- System gain display

MCS-204 (only)

- Front panel torque adjustment
- Remote potentionmeter adjustment
- Roll follower input
- Remote voltage or current analog signal following

Magnetic Capping Headset Replacements

Warner Electric's unique product design enables longer life for your magnetic headset.

Spring Cover

Keeps lubrication within the unit, extends the life of the top load components.

Grease Access Point

Easy to maintain. Lubricate the upper assembly every 500 hours.



Grease Access Point

Stainless Steel **Construction**, Quad Seal, and Drain Holes

The quad seal helps to protect the bearing from contaminants. The drain holes allow for an exit if any fluids get inside of the unit. These features combined with stainless steel construction enable the units to better withstand harsh environments, including caustic washdowns!

Visual Setting Scale for Application Torque

Easy to set up and maintain. This setting scale provides easy, accurate setting of application torque.

Warner Electric capping headsets are 100% interchangeable with major OEM models including:

- ALCOA • ZALKIN • AMCO
- FOGG
- AROL
- KRONES
- FOWLER

PAT. NO. 7181892

743437

KHS



Visual Setting Scale for Setting Top Load Force

Easy to set up. This setting scale provides easy accurate setting of top load force.

Oversized Thrust Bearing

Specifically designed for the bottling industry with an oversized thrust bearing to handle the repeated downward thrust of capping, increasing bearing life compared to a standard radial ball bearing used by competitive models.

This bearing is not incorporated on all models.

Smooth Torque Technology

Eliminates cap over-tightening, reduces variation in removal torque, and provides less shock wear on the system.



Warner Electric units utilize a four dowel pin design, reducing wear significantly when compared to the keyed design of competitive units.

Featuring Smooth Torque magnetic technology to provide the most consistent torque control on the market

Warner Electric magnetic headsets feature constant Smooth Torque Technology; differing with most competitor OEM headsets that have two opposing magnets causing pulsating torque. It's the pounding effect of a pulsating clutch that increases cap tightness during the capping process.

Warner Electric's Smooth Torque Technology enables Warner headsets to provide constant torque. This eliminates over tightened caps, causing a major reduction in variation of removal torque!

Competition

variation

torque

in removal


Smooth Torque Technology provides less shock on the system compared to pulsating torque headsets, enabling longer life of machine components, especially retention knives.


- 100% Interchangeable with Major OEM Headsets
- Smooth Torque
- Improved Efficiency
- Longer Operating Life and Lower Cost of Ownership
- Lower Operating Costs
- Easy to Set-up & Maintain
- Excellent Service Expertise and Delivery

Easy Rebuilds!

- Full rebuild kits available
- No expensive maintenance contracts
- Save time and money by repairing the headsets yourself

Repair Kits	Model
Bearing Repair Kit	M4.5-BK
Magnet Repair Kit	M4.5-MK
Tool Kit	M4.5-TK

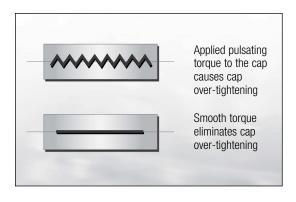

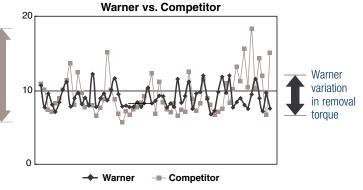

Each data point is a measurement from one sample bottle from competitive headsets running on the same machine.

Other Rebuild Options

- Factory Repair Programs
- Exchange Program
- Ask for details

Many Warner headsets available off the shelf!

Replacement Headsets for Alcoa OEM Machines

Alcoa Model	Warner Model
Magna Torq	M4.5-001
Magna Torq2000	M4.5-002
VK560	M4.5-007

Replacement Headsets for Other Major OEM Machines

	Warner Models
Zalkin	M4.5-025 M4.5-035
Fogg	M4.5-004 M4.5-034
AROL	M4.5-010 M4.5-027 M4.5-032

Capping Packages Designed for Dairy Applications

Warner Electric has recently introduced new capping packages specifically designed for the dairy industry. These products are 100% interchangeable with the OEM capping machinery found in dairy plants today. Designed to provide maximum corrosion resistance in caustic washdown environments, Warner headsets are engineered to help you reduce maintenance costs and keep your dairy plants' downtime to a minimum!

- Designed to withstand caustic washdown environments
 - Completely sealed unit prevents fluids from getting into the clutch
 - All Stainless steel construction
- More consistent torque, improving quality and efficiency
- Reduced plant downtime
 - Improved visual adjustment capabilities for application torque
 - Provides longer operating life than comparable OEMs
- Lower overall operating costs
- Cost-effective solutions with short lead times
- Quieter machine operation
- Chucks are easily cleaned
- Smooth torque eliminates bottle damage from kicker fingers



Federal/Portola/ Blackhawk Capping System

Warner Electric Replacement for the Federal/Portola/ Blackhawk Capping System



• 100% interchangeable with the Federal/Portola capping system.

Federal GEM style Capping Clutch


Warner Electric Replacement for the Federal GEM style Capping Clutch

- Direct replacement for the Federal GEM capping clutch.
- 100% Interchangeable with the Federal GEM capping clutch.

Fogg Capping Headset

Warner Electric Replacement for the Fogg Capping Headset

- Direct interchange for the Fogg capping headset commonly used in the dairy industry.
- 100% interchangeable, no machine modification required.





Warner Electric is your Engineered Cap Chuck Solution

- Chucks engineered to fit your cap profile
- Manufactured to be 100% interchangeable with existing OEM chucks
- Manufactured from highly corrosion resistant hardened stainless steel material
- Unique cap chuck pin designed to better grip your cap
- Competitively priced and short lead times



Fixed Chucks



- Simple design, least amount of wearing parts
- Low maintenance
- Low inertia
- Short lead times

Quick Connect Chucks



- Quick changeover ideal for multiple package sizes or frequent cleaning
- Designed for any OEM headset to meet your application needs

Mechanical Chucks



- Ideal for multiple cap sizes, difficult cap grip applications, and smooth caps
- Hardened stainless steel
 used in key wear areas
- Competitively priced

Warner Electric is the Preferred Supplier for Low Profile Cap Applications



- Experienced in providing quality chucks for new low profile cap applications
- Provided one of the top performing PTOC chucks to the CSD industry
- Industry leader in providing 1881 style and Savalas low profile cap chucks
- Our extensive design experience has enabled us to engineer our chucks to reduce cocked caps

Notes

Notes

The power of one, the strength of many.

Other product solutions from

Altra Industrial Motion

Our comprehensive product offering is comprised of nine major categories including electromagnetic clutches and brakes, heavy duty clutches and brakes, overrunning clutches, gearing, engineered couplings, engineered bearing assemblies, linear products and belted drives. With thousands of product solutions available, Altra provides true single source convenience while meeting specific customer requirements. Many major OEM's and end users prefer Altra products as their No.1 choice for performance and reliability.



Electromagnetic **Clutches and Brakes**

Warner Electric Inertia Dynamics Matrix International



Heavy Duty Clutches and Brakes

Wichita Clutch Twiflex Limited Industrial Clutch



Over Clutches

Formsprag Clutch Marland Clutch Stieber Clutch

Gearing

Boston Gear

Nuttall Gear

Delrovd Worm Gear

Bauer Gear Motor



Engineered Couplings and Universal Joints

TB Wood's **Ameridrives Couplings** Ameridrives Power Transmission **Bibby Turboflex** Lamiflex Couplings



Linear Products Warner Linear



Belted Drives and Sheaves

TB Wood's





Precision Couplings and Air Motors Huco Dynatork



Engineered **Bearing Assemblies** Kilian Manufacturing

www.altramotion.com

All Customer Service phone numbers shown in bold

Electromagnetic Clutches and Brakes

Warner Electric Electromagnetic Clutches and Brakes

New Hartford, CT - USA 1-800-825-6544

For application assistance: 1-800-825-9050

St Barthelemy d'Anjou, France +33 (0) 2 41 21 24 24

Precision Electric Coils and Electromagnetic Clutches and Brakes Columbia City, IN - USA 1-260-244-6183

Matrix International

Electromagnetic Clutches and Brakes, Pressure Operated Clutches and Brakes

Brechin, Scotland +44 (0) 1356 602000 New Hartford, CT - USA 1-800-825-6544

Inertia Dynamics

Spring Set Brakes; Power On and Wrap Spring Clutch/Brakes New Hartford, CT - USA 1-800-800-6445

Linear Products

Warner Linear Linear Actuators Belvidere, IL - USA 1-800-825-6544

For application assistance: 1-800-825-9050

St Barthelemy d'Anjou, France +33 (0) 2 41 21 24 24

Couplings

Ameridrives Couplings Mill Spindles, Ameriflex, Ameridisc Erie, PA - USA 1-814-480-5000

Gear Couplings San Marcos, TX - USA **1-800-458-0887**

Bibby Turboflex Disc, Gear, Grid Couplings, Overload Clutches Dewsbury, England +44 (0) 1924 460801

Boksburg, South Africa +27 11 918 4270

TB Wood's Elastomeric Couplings Chambersburg, PA - USA 1-888-829-6637 - Press #5 For application assistance: 1-888-829-6637 - Press #7

General Purpose Disc Couplings San Marcos, TX - USA 1-888-449-9439

Ameridrives Power Transmission Universal Joints, Drive Shafts, Mill Gear Couplings Green Bay, WI - USA 1-920-593-2444

Huco Dynatork Precision Couplings and Air Motors Hertford, England +44 (0) 1992 501900 Chambersburg, PA - USA 1-888-829-6637

Lamiflex Couplings Flexible Couplings, Bearing Isolators, and Coupling Guards São Paulo, SP - Brasil +55-11-5679-6533

Heavy Duty Clutches and Brakes

Wichita Clutch Pneumatic Clutches and Brakes Wichita Falls, TX - USA 1-800-964-3262 Bedford, England +44 (0) 1234 350311

Twiflex Limited Caliper Brakes and Thrusters Twickenham, England +44 (0) 20 8894 1161

Industrial Clutch Pneumatic and Oil Immersed Clutches and Brakes Waukesha, WI - USA 1-262-547-3357

Gearing

Boston Gear

Enclosed and Open Gearing, Electrical and Mechanical P.T. Components Charlotte, NC - USA 1-800-825-6544

For application assistance: 1-800-816-5608

Bauer Gear Motor Geared Motors Esslingen, Germany +49 (711) 3518 0 Somerset, NJ - USA 1-732-469-8770

Nuttall Gear and Delroyd Worm Gear Worm Gear and Helical Speed Reducers Niagara Falls, NY - USA 1-716-298-4100

Overrunning Clutches

Formsprag Clutch

Overrunning Clutches and Holdbacks Warren, MI - USA 1-800-348-0881 – Press #1 For application assistance: 1-800-348-0881 – Press #2

Marland Clutch

Roller Ramp and Sprag Type Overrunning Clutches and Backstops South Beloit, IL - USA 1-800-216-3515

Stieber Clutch

Overrunning Clutches and Holdbacks Heidelberg, Germany +49 (0) 6221 30 47 0

Belted Drives and Sheaves

TB Wood's

Belted Drives Chambersburg, PA - USA 1-888-829-6637 – Press #5 For application assistance: 1-888-829-6637 – Press #7

Engineered Bearing Assemblies

Kilian Manufacturing Engineered Bearing Assemblies Syracuse, NY - USA 1-315-432-0700

For information concerning our sales offices in Asia Pacific check our website www.altramotion.com.cn



www.warnerelectric.com

31 Industrial Park Road New Hartford, CT 06057 - USA 815-389-3771 Fax: 815-389-2582